


CORNER RESTORATION

E 1/4 Sec. Cor.
CORNER Sec. 25 TWP 13S RANGE 32E

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

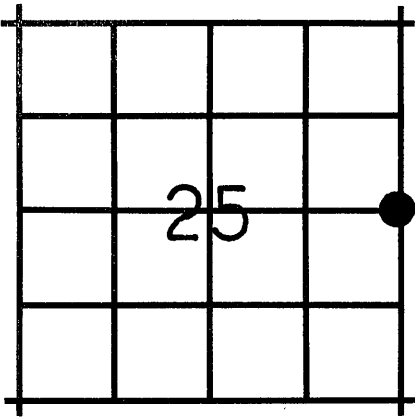


ORIGINAL DESCRIPTION:

South along West boundary Sec. 30 (R33E)

40.00 set 18x12x5 stone for 1/4 Sec. cor.


RESTORATION BY, STAMP AND DATE:

R. D. Bagett
S. F. Jackson

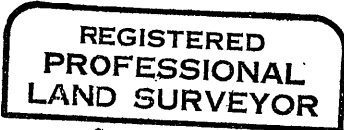

Robert D. Bagett

April 19, 1978

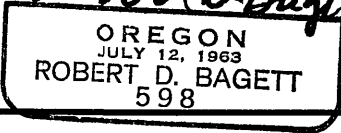

Grant County Surveyor

EVIDENCE FOUND:

Found basalt stone 18"x12"x5" marked 1/4 in fence jack. Since it is obvious the original corner stone was moved, and no other evidence of the position of the corner was found, I establish the 1/4 corner at single proportionate measure between nearest found corners on the range line.

See Map of Survey No. 502


DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a 1 1/2"x30" iron pipe 24" in the ground with brass cap marked as shown. MONUMENT MARKED

No bearing trees available.

Buried original 1/4 corner stone South and alongside the iron pipe and surrounded pipe with mound of stone to top of cap.

Corner is S. 18° W., 125 feet from corner of fences running North-South-East.

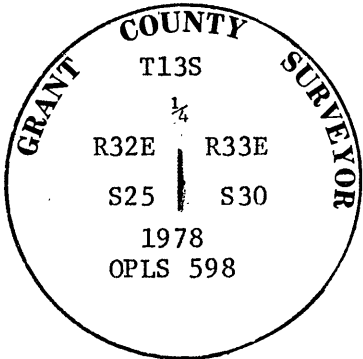

RECEIVED AND
FILED

APR 25 1978

JOHN LIVEIRA, County Clerk

By *Sammie Lawrence* Deputy