


# CORNER RESTORATION

West 1/4 Cor.  
**CORNER** Sec. 13 **TWP** 13 S. **RANGE** 33 E., W.M.

**ORIGINAL SURVEY BY:** John B. David

**CONTRACT NUMBER:** 131

**CONTRACT DATE:** June 8, 1869

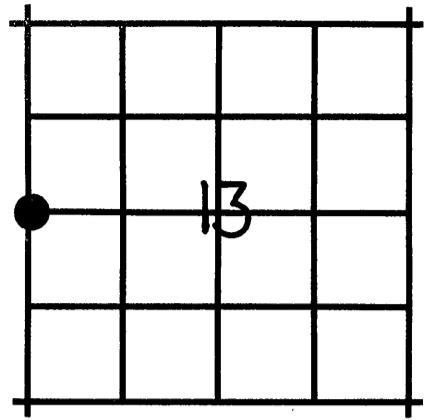

**ORIGINAL DESCRIPTION:**

GLO NOTES: North between Sec's 13 & 14 40.00 chains. Set stone 14x9x7 for 1/4 Sec. Cor.

**RECEIVED AND FILED**

**MAY 24 1988**

OFFICE OF COUNTY SURVEYOR  
*Robert D. Baggett*  
 Attest: *John B. Watson*

**RESTORATION BY, STAMP AND DATE:**

R. D. Baggett  
 J. L. Watson  
 K. J. Workman

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Robert D. Baggett*  
 OREGON  
 JULY 12, 1963  
 ROBERT D. BAGETT  
 598

April 11, 1988

Grant County Surveyor

**EVIDENCE FOUND:**

I did not find any evidence of this 1/4 corner. After a diligent search I declared the corner lost and set the corner at single proportionate measure between the found Southwest corner of Sec. 13 and the accepted corner at the Northwest corner of Sec. 13. This position is in a East-West fence line, about 15' ft. East of angle point in fence where fence turns Southwest.

See Map of Survey No. 1036

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

**Show how trees are scribed and basis of bearings, including compass var.**

At the Corner point: Set a 1 1/2"x30" galvanized iron pipe 30 inches in the ground with brass cap marked as shown:  
 from which I set NEW REFERENCE POINTS:

A 5/8" x 18" iron pin, driven flush with the ground, bears East, 10.0 ft., with attached plastic cap marked BGA SURVEY MARKER, set in East-West fence line.

A 5/8" x 18" iron pin, driven flush with the ground, bears West, 10.0 ft., with attached plastic cap marked BGA SURVEY MARKER, set in East-West fence.

Used magnetic compass with 20° East variation and steel tape for measurements to reference points.

No bearing trees or bearing objects available.

**MONUMENT MARKED**

