


# CORNER RESTORATION

SW Cor.  
**CORNER** Sec. 13 **TWP** 13 S. **RANGE** 33 E., W.M.

**ORIGINAL SURVEY BY:** John B. David

**CONTRACT NUMBER:** 131

**CONTRACT DATE:** June 8, 1869

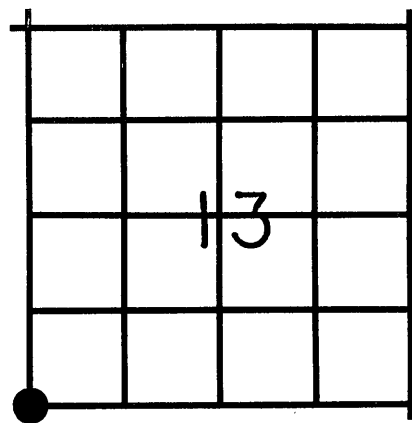

**ORIGINAL DESCRIPTION:**

Set stone 15x10x8 for corner to Secs. 13, 14, 23 & 24.

**RECEIVED AND FILED**

**MAY 24 1988**

OFFICE OF COUNTY SURVEYOR  
*Robert D. Bagett*  
 Attest: *John L. Watson*

**RESTORATION BY, STAMP AND DATE:**

R. D. Bagett  
 J. L. Watson  
 K. J. Workman

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

OREGON  
 JULY 12, 1933  
 ROBERT D. BAGETT  
 598

April 11, 1988

Grant County Surveyor

**EVIDENCE FOUND:**

Found basalt stone 15x10x9 dimly marked with 3 notches on South face set in a ring of stone. I accept this stone for the position of the section corner.

See Map of Survey No. 1036

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

Show how trees are scribed and basis of bearings, including compass var.


At the corner point: Set a 1½"x30" iron pipe 28 inches in the ground, with brass cap marked as shown:  
 from which I set NEW REFERENCE POINTS:

**MONUMENT MARKED**

A 5/8" x 30" iron pin bears N. 0° 06' 52" E., 25.00 ft., with attached plastic cap marked BGA SURVEY MARKER.

A 5/8" x 30" iron pin bears S. 89° 52' 24" E., 25.00 ft., with attached plastic cap marked BGA SURVEY MARKER.

A 5/8" x 30" iron pin bears S. 89° 48' 10" W., 25.00 ft., with attached plastic cap marked BGA SURVEY MARKER.

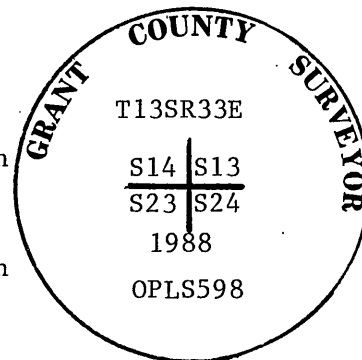

Buried corner stone East and along side iron pipe and raised a mound of stone, 3 ft. base, to top of cap.

Bearings are based on solar observation.

No bearing trees or bearing objects available.