


CORNER RESTORATION

CORNER $W\frac{1}{4}$ Cor.
Sec. 27 TWP 13 S. RANGE 34 E.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June, 1869

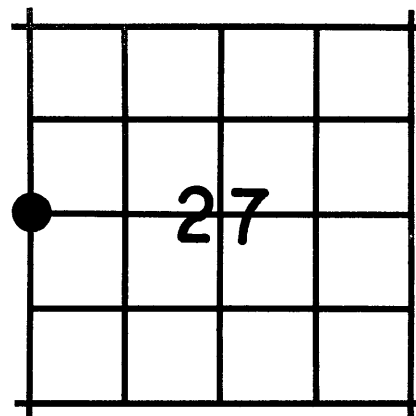

ORIGINAL DESCRIPTION: Set stone 14x10x6 for $\frac{1}{4}$ Section Corner. This corner was searched for, not found, and re-established by Michael Spears, County Surveyor. Spear's record states: $W\frac{1}{4}$ corner, Sec. 27, Rock 18"x10"x6" set deep to bedrock in mound of rocks. Recorded in Surveyors Record Book 1, Page 17, dated Nov. 16, 1908.

RESTORATION BY, STAMP AND DATE:

R. D. Baggett
J. L. Watson

RECEIVED AND
FILED

OCT 30 1989

OFFICE OF COUNTY SURVEYOR
Attest: *Robert D. Baggett*

Sept. 15, 1989

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett

OREGON
JULY 12, 1969
ROBERT D. BAGETT
598

Grant County Surveyor

EVIDENCE FOUND: Found a stone 20"x10"x7" firmly set upright, 10" in the ground to bedrock, dimly marked $\frac{1}{4}$ on upper West face and possible C of record CS is visible. This stone was 2 ft. South of the SW corner of a lane fence 30 ft. wide which runs North $\frac{3}{4}$ mile. I accept this as the $\frac{1}{4}$ corner set by Michael Spears in 1908.

See Record Map of Survey No. 1109.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the Corner Point: I set a 1 $\frac{1}{2}$ "x30" galvanized iron pipe, 10" in the ground to bedrock, with attached brass cap marked as shown. From which I set New Reference Points:

A 5/8"x30" iron pin bears North, 20.00 ft. with attached aluminum cap marked Grant County Surveyor RP1 1989 OPLS 598.

A 5/8" iron pin bears East, 50.00 ft. with attached aluminum cap marked Grant County Surveyor RP2 1989 OPLS 598.

Both pins are set in fence line.

I buried the marked stone South and alongside the iron pipe and raised a mound of stone to top of cap. Used Magnetic Compass with 20° E. variation and a steel tape.

MONUMENT MARKED

