


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Bamford Robb under General Land Office Contract No. 383 dated March 26, 1881.

Survey General's records state:

Set basalt stone 24"x16"x12" in mound of stones for cor. to sec's. 8/9,16 & 17. Var. 19°30'

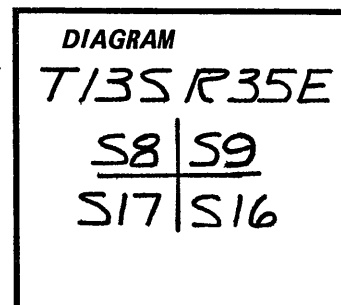

Description of corner evidence found:


At assumed corner location found that a logging road had been built through the corner area destroying the original corner evidence. Found a Ponderosa Pine snag, 32" DBH, with two older form 458's (U.S.F.S. metal location tag) nailed to west side of tree lying East of logging road at top of cutbank. One 458 tag was initialed "S.J., J.V. 7-46 and UDELL?" with "CR. 25' W.". Other form 458 was initialed "R.G.K. 7/2/61 SEC. COR. 25' W. 22 AUG. 57 W.L.S. D.D.B.". We researched the U.S.F.S. Form 52 records and found that Robert G. Keller (R.G.K.) on 1/7/63 had found the corner stone 24"x16"x12" in a mound 12" above ground in good condition with stone marked 4 notches on south face and 4 notches on east face. Record also states a form 458 was posted. Since the written record substantiates that the tree tagged with form 458's co-existed harmoniously with the original corner stone and mound the tree is the best available perpetuated evidence of the original corner position. Description of monument and accessories established to perpetuate the

original location of this corner:

As the evidence in the vicinity of the assumed corner agrees with the perpetuated original G.L.O. record at a point 25.0 feet West of the face of the said form 458 tagged Ponderosa Pine snag set a 30" long 2 1/2" O.D. aluminum pipe 15" in ground with 3 1/4" aluminum cap marked:

Marked new bearing trees:

A Ponderosa Pine, 8" DBH, bears North 12° East, 21.6 feet, scribed "T13S R35E S9 BT";
 a Douglas Fir, 13" DBH, bears South 18° East, 36.4 feet, scribed "T13S R35E S16 BT";
 a Douglas Fir, 12" DBH, bears South 54° West, 38.2 feet, scribed "T13S R35E S17 BT";
 a Douglas Fir, 16" DBH, bears North 65° West, 29.5 feet, scribed "T13S R35E S8 BT".

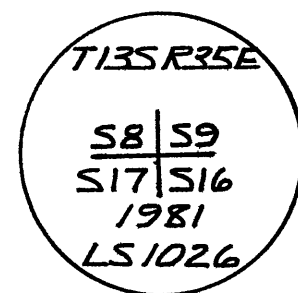

Raised a mound of stones 2 1/2 feet base to top of cap. Painted 6" red band and painted faces red and nailed signs 54-3 and 54-4 to bearing trees. Nailed brass washers stamped "LS 1026" to lower blaze of new bearing trees. Set steel posts with signs 54-2 and 54-4 south and east of corner.

Declin. 19°30"E

I hereby certify the above corner monument was re-established as herein described on September 14, 1981.

Witnesses: William S. DeGroot, LS 1633 Shelby H. Griggs, Chairman
 William S. DeGroot, LS 1633 Shelby H. Griggs, Chairman

Office of Surveyor County of Grant
 State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 19 day of Oct, 1981.
Robert D. Baggett by _____
 (COUNTY OFFICIAL) (DEPUTY)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David B. Armstrong
 9/29/81 OREGON
 906789-522, 1975
 DAVID B. ARMSTRONG
 1026

Form R6-7100-57 (9/71)