

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner established by Bamford Robb under General Land Office Contract No. 383 dated March 26, 1881.

Surveyor General's records state:

Set basalt stone 22"x18"x10" in a mound of stones for cor. to sec's 17,18,19, & 20.

From which:

- a Pine, 42 in. dia., bears N 35°E, 59 lks,
- a Pine, 28 in. dia., bears N9°W, 58 lks.

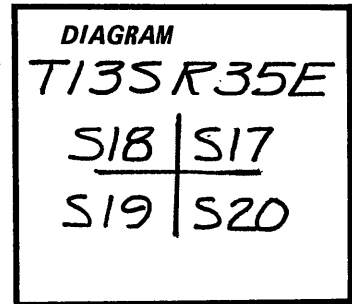

Description of corner evidence found:


Found a basalt stone 24" X 18" X 8" plainly marked with 3 grooves on the south face and 5 notches on the top-east side. The stone was found firmly set upright in a mound with 7 other stones well silted in with earth and duff. Found the original NW bearing tree, a Ponderosa Pine, 27"DBH, bears North 5° West, 38.8 feet (to face) marked with chopped open blaze face with visible scribing "T 1 R" and part of "T" on lower blaze, and further marked with old form 458 USFS location tag initialed "RGK 7/19/61". Found the remains of the original NE bearing tree, a rotted Ponderosa Pine, dead and down, bears North 38° East, 38.9 feet with no remaining marks visible on badly deteriorated tree.

Description of monument and accessories | established to perpetuate the original location of this corner:

As evidence in vicinity of corner agrees with the original G.L.O. record, at the location of the original marked stone in stone mound, set a 30" long 2 1/2" O.D. aluminum pipe 20" in ground with a 3 1/4" aluminum cap marked as shown:

Marked new bearing trees:

- A Ponderosa Pine, 14" DBH, bears North 55° East, 52.6 feet, scribed "T13S R35E S17 BT";
- a Ponderosa Pine, 9"DBH, bears South 18° East, 59.4 feet, scribed "T13S R35E S20 BT";
- a Douglas Fir, 8" DBH, bears South 60° East, 40.7 feet, scribed "T13S R35E S19 BT".

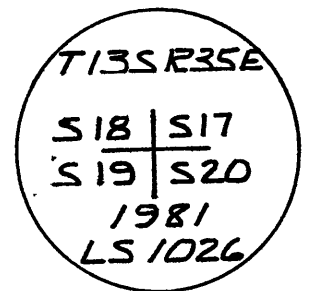

Declin. 20°E

From which the original bearing tree:

A Ponderosa Pine, 27" DBH, bears North 5° West, 39.6 feet, marked with visible scribing "T 1 R" and part of "T" on lower blaze.

Raised stone mound 2 feet base to top of cap and buried original stone on North side of pipe.

Painted 6" red band and faces red and nailed signs 54-3 and 54-4 on all bearing trees. Nailed brass washers stamped "LS 1026" on all new bearing trees. Set steel post north of pipe with sign 54-4 bolted to post.

I hereby certify the above corner monument was re-established as herein described on August 20, 1981.

Witnesses: William S. DeGroot, LS 1633 Shelby H. Griggs
Office of... Sevier Co., Tenn. County of... Grant

State of... Tenn. I hereby certify that the within instrument was filed in this office

for record on the... 19 day of... Oct... 1981

Robert D. Baggett by

(COUNTY OFFICIAL)

(DEPUTY)

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

David B. Armstrong

9/29/81 GPO 399-508 OREGON
AUGUST 22, 1975
DAVID B. ARMSTRONG
1026