

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner established by Bamford Robb under General Land Office Contract No. 383 dated March 26, 1881.

Surveyor General's records state:

Set basalt stone 14"x8"x5" in a mound of stones for cor. sec's. 15,16,21,22

From which:

- a tamarack, 10" dia., bears S 40° W, 11 lks dist.
- a tamarack, 10" dia., bears N 12° E, 9 lks dist.

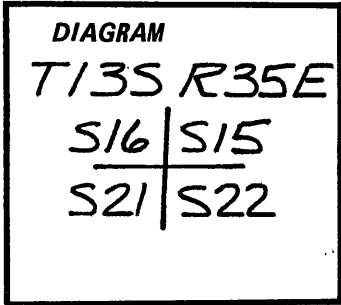

Description of corner evidence found:


At the assumed corner location found a basalt stone 14" X 8" X 5" marked with 3 notches on east edge 3 notches on south edge and "X" on top. Stone was found undisturbed firmly set upright in mound of 6 other stones well silted in with earth and duff. Found remains of original NE bearing tree, a Lodgepole Pine, 10" diameter, rotted, dead and down marked with visible scribing "S15 T13 R35" and chaining notch on exposed blazed face, the base of which bears, North 12° East, 6.0 feet distance. Found the remains of the original SW bearing tree, a Lodgepole Pine, 8" diameter, dead and down, marked with visible scribing "S21 T13 R35" and chaining notch in good condition on exposed blazed face facing the ground, bears South 20° West, 7.3 feet to base. Found form 458 on tree north of corner initialed GWD & RGK 8/16/63. Also found form 458 2 1/2 chains North by RGK and 18 chains West by RGK.

Description of monument and accessories established to perpetuate the original location of this corner:

As evidence in vicinity of corner agrees with G.L.O. original record, at the location of the original stone in stone mound set a 30" long 2 1/2" O.D. aluminum pipe 24" in ground with 3 1/4" aluminum cap marked:

Marked new bearing trees:

- A Douglas Fir, 11" DBH, bears North 33° East, 21.7 feet, scribed "T13S R35E S15 BT";
- a White Fir, 9" DBH, bears South 66° East, 29.2 feet, scribed "T13S R35E S22 BT";
- a Douglas Fir, 16" DBH, bears South 30° West, 19.0 feet, scribed "T13S R35E S21 BT"
- a Douglas Fir, 14" DBH, bears North 86° West, 32.3 feet, scribed "T13S R35E S16 BT".

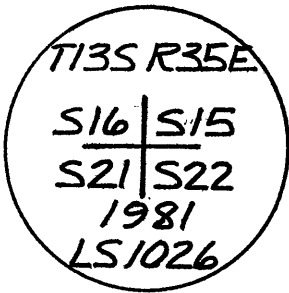

Declin. 19°E

Raised a mound of stone 2 feet base to top of cap and buried original stone north of cap. Painted 6" red band and faces red and nailed signs 54-3 and 54-4 on bearing trees. Nailed brass washers stamped "LS 1026" on all new bearing trees. Set steel posts north and west of corner with signs 54-2 and 54-4 bolted to posts.

I hereby certify the above corner monument was re-established as herein described on August 25, 1981.

Witnesses: William S. DeGroot
William S. DeGroot, LS 1633

Shelby H. Griggs
Shelby H. Griggs, Chairman

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 19 day of Oct, 1981
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David B. Armstrong
9/29/81 REGON
AUGUST 22, 1973
DAVID B. ARMSTRONG
1026

Form R6-7100-57 (9/71)