


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established in 1881
by Robb & Graden:
Set basalt stone 18x16x14 in mound
of stone from which:
A 42" Pine brs. N60°W 37 lxs. (24.4')
A 12" Pine brs. N44°E 46 lxs. (30.4')

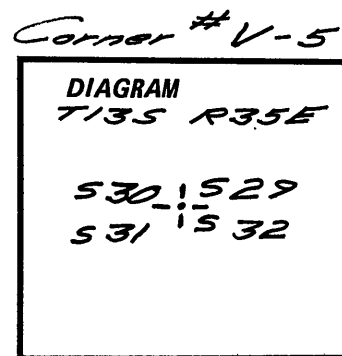

Description of corner evidence found:

Found 14"x14"x12" stone, with 1 notch South, in stone collar.

A Pine snag brs. N55°W 26.7'; scribes visible.
A 28" Ponderosa Pine brs. N40°E 35.1'; scar facing properly.

Description of monument and accessories | established to perpetuate the original location of this corner:

Set 2 1/2" x 30" aluminum pipe with 3" aluminum cap rising 6" in stone mound. Buried original stone alongside. Cap marked

New BTs:

A 5" Ponderosa Pine brs. S77°E 26.4'
marked X BT.
A 7" Ponderosa Pine brs. S82°W 93.0'
marked T135 R35E S31 BT.
A 8" Ponderosa Pine brs. N12°W 5.9'
marked T135 R35E S30 BT.

T135 R35E

530-1529
531-1532
1986
LS1020

I hereby certify the above corner point was perpetuated as described in June, 1986, U.S.F.S. bearing tree signs were placed on each BT and a 6" red band was painted around each BT.

Office of..... Surveyor County of..... Grant
State of..... OREGON, I hereby certify that the within instrument was filed in this office
for record on the..... 3 day of..... Sept 19..... 86
..... Robert D. Dwyer by
(COUNTY OFFICIAL) (DEPUTY)

