CORNER RESTORATION

CORNER: W1/4 SEC. 12, TWP. 13 S., RANGE 26 E., W.M.

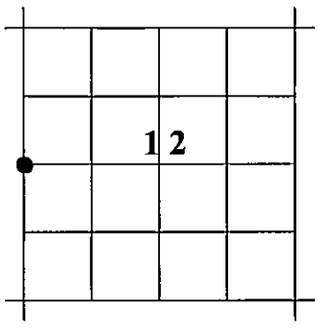

ORIGINAL SURVEY BY: Jason Owen, Deputy Surveyor

CONTRACT NUMBER: 194

CONTRACT DATE: July 1, 1873

SUBSEQUENT SURVEYS:
- By Vernon Glaze, Grant County Surveyor in 1914

ORIGINAL GLO DESCRIPTION: *Set Stone 16x10x5 for 1/4 Sec. cor.*
- 1914 DESCRIPTION: During the course of survey No. 7G, the corner was remonumented by Vernon Glaze with a brass cap. His record states: *Common Gov 1/4 cor Sec 11-12 set iron post Brass cap marked and wooden post 4x4x4.0 Scribed. erected monument of Stone. . .*

EVIDENCE FOUND AND NEW ACCESSORIES: Found the 1" iron pipe with attached brass cap set by Glaze. The cap is marked as shown below. Monument is at the corner of fences running North, East and remains of a fence running south. The monument leans Easterly. I took my GPS observation and measured to the BT's from the top of the cap.

FROM WHICH, I SCRIBE THE FOLLOWING BEARING TREES
A juniper, 7" diam. bears N.66°E., 9.15 feet marked S12 BT
A juniper, 4" diam. bears S.73°E., 21.80 feet marked 1/4 S12 BT
A juniper, 6½" diam. bears S.30°W., 20.60 feet marked 1/4 S11 BT
A juniper, 4½" diam. bears N.45°W., 15.70 feet marked 1/4 S11 BT

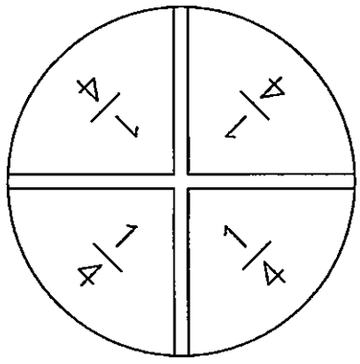

Used a steel tape and compass with a 15° East declination to measure to BT's. Distances to BT's are measured to a 50d nail driven in to the side-center near the root crown. Placed BT tags on the trees.

STATE PLANE COORDINATES (3601 OR N)
Reference Datum: NAD83 From OPUS solution

Northing: 288,662.9 ft.
Easting: 8,449,573.2 ft.
Ellip. Ht: 2,703.8 ft.

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, PLS, Grant County Surveyor
Jason L. Hatfield, PLS, Deputy County Surveyor

Surveyed October 18, 2012

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

OCT 24 2012

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2014