CORNER RESTORATION

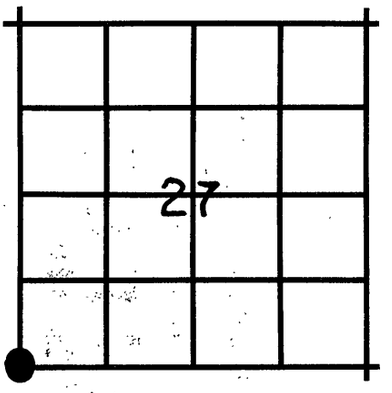

CORNER SW Cor Sec. 27 **TWP** 13 S. **RANGE** 30 E., W.M.

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

ORIGINAL DESCRIPTION:

Set stone 15x8x6 for corner to Secs. 27, 28, 33 and 34.

RECEIVED AND FILED
AUG 11 1983
OFFICE OF COUNTY SURVEYOR
Robert D Bagett
Attest: Hammie Lavanne

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
J. L. Watson
G. T. Blackman

July 29, 1983

REGISTERED PROFESSIONAL LAND SURVEYOR
Robert D Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Grant County Surveyor.

EVIDENCE FOUND:

Found a ring of stone 20" diam., firmly placed in ground. I accepted the position of this ring of stone for the corner of sections 27, 28, 33 and 34. It is harmoniously related to other known corners in the area. I also found the original corner stone in the remains of an old N-S fenceline some 200 feet South of corner where someone had used it for a fence weight. The corner is near the intersection of the remains of old fence lines running N-S and W.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 1½"x30" galvanized iron pipe 26" in the ground with brass cap marked as shown, from which I scribe NEW BEARING TREES:

A Juniper 12" in diam., bears N. 13° E., 150.0 ft., mkd. T13SR30ES27 CSBT.
A Juniper 8" in diam., bears N. 22° W., 126.7 ft., mkd. T13SR30ES28 CSBT.

No bearing trees available in Secs. 33 and 34.

I buried the original corner stone North and alongside the iron pipe and surrounded pipe with a mound of stone, 3 ft. base to top of cap. Used magnetic compass and steel tape, measuring to the head of a 40 d nail, driven flush with the BT blaze at the root crown of the bearing trees.

MONUMENT MARKED

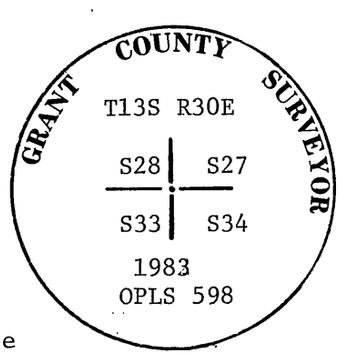

V-13