CORNER RESTORATION

CORNER: SW SEC. 3, TWP. 13 S., RANGE 33 E., W.M.

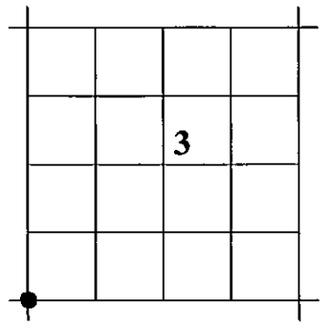

ORIGINAL SURVEY BY: John B. David

CONTRACT NUMBER: 131

CONTRACT DATE: June 8, 1869

SUBSEQUENT SURVEYS:

- By Robert Bagett, County Surveyor in 1988

ORIGINAL GLO DESCRIPTION: *set stone 16"x10"x5" for corner to sections 3, 4, 9 and 10.*

- 1988: Corner was remonumented by Bagett with a County Surveyor brass cap. His record states: *I found the original basalt corner stone 18x9x6 inches, marked with 3 grooves on East face and 5 grooves on South Face. At the corner point: Set a 1½"x30" Galv. iron pipe 28 inches in the ground with attached brass cap marked as shown.*
  From which I set NEW REFERENCE POINTS:
  A 5/8"x30" iron pin with attached 1½" Aluminum Cap bears N.45°E., 30.00 ft., marked Grant County Surveyor RP1 1988.
  A 5/8"x30" iron pin with attached 1½" Aluminum Cap bears S.45°E., 30.00 ft., marked Grant County Surveyor RP2 1988.
  A 5/8"x30" iron pin with attached 1½" Aluminum Cap bears S.45°W., 30.00 ft., marked Grant County Surveyor RP3 1988.
  A 5/8"x30" iron pin with attached 1½" Aluminum Cap bears N.45°W., 30.00 ft., marked Grant County Surveyor RP4 1988. Set in a East-West fence line.
  Buried marked stone, South, and alongside the iron pipe. This corner falls in a North-South fence line 20 feet south of a fence corner. . .

EVIDENCE FOUND AND NEW ACCESSORIES: Found a 1½" iron pipe with attached Grant County Surveyor brass cap, marked as shown below. I found the reference points set by Bagett in 1988 in good condition.

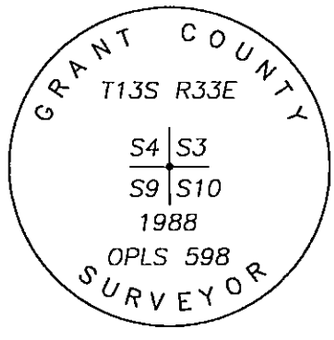

STATE PLANE COORDINATES (3601 OR N)
Reference Datum: NAD83 From OPUS solution

Northing: 294,636.3 ft.
Easting: 8,662,373.6 ft.
Ellip. Ht: 3,658.5 ft.

RESTORATION BY, STAMP AND DATE:
Michael C. Springer, Grant County Surveyor

Surveyed September 16, 2012

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

SEP 19 2012

BY: _____

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2014