


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Mark A. Fullerton under General Land Office Contract No. 395 dated May 25, 1881.

Surveyor General's records state:

North on line between sec's 15 & 16
80.00 Set basalt stone 18X12X5 in stone mound
for cor to sec's 9, 10, 15 & 16

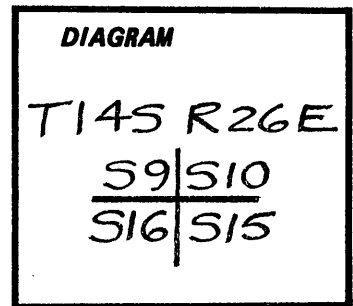

J-13

Description of corner evidence found:


Found a basalt stone 18"X12"X5" (very rectangular) setting on top of 2 foot high 3 foot diameter stone mound newly constructed and covered with orange paint. Stone appeared to have 2 grooves on one face but could identify no other marks. Found a 13" dbh Juniper (now the SE BT) with chopped out face and State Forestry Dept. boundary sign bears South 25° East, 11.7ft.. Found old brushed lines south and west from corner. Contacted State Forestry Dept. in John Day and they confirmed that they had found stone set in smaller mound at that location in January, 1981, and had re-built mound and painted stones. Mound rests on shallow soil but some of the lower stones were in casts and were remnants of the original mound.

Description of monument and accessories established to perpetuate the original location of this corner:

As the evidence in the corner vicinity agrees with the G.L.O. original record, at the location of the found original stone in mound of stones, set 30 inch long 2 inch I.D. aluminum pipe 6 inches in ground to bedrock with 3 1/4 inch aluminum cap marked as shown:

Marked new bearing trees: an 18" dbh Juniper bears North 24° East, 12.3 ft. scribed T14SR26ES10BT; a 13" dbh Juniper bears South 25° East, 11.7 ft. scribed T14SR26ES15BT; a 16" dbh Juniper bears South 32 1/2° West, 20.9 ft. scribed T14SR26ES16BT; a 20" dbh Juniper bears North 70° West, 38.9 ft. scribed T14SR26ES9BT.

Nailed brass washer marked "LS 1026" in lower blaze.

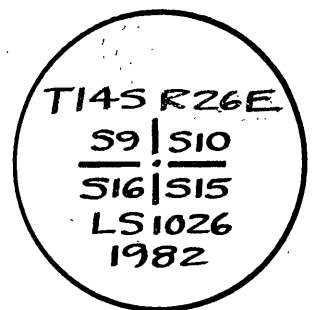

Magnetic Declination

20° EAST

Raised a mound of stones 4 foot base to top of cap and buried the original stone EAST of cap. Set steel post with sign 54-4 5 1/2 feet SOUTH of and facing cap. Painted 6 inch red band and faces red and nailed signs 54-3 and 54-4 on all bearing trees.

I hereby certify the above corner monument was re-established as herein described on JULY 29, 1982.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David B. Armstrong

OREGON
AUGUST 22, 1973
DAVID B. ARMSTRONG
1026

Office of Surveyor County of Grant
State of Oregon I hereby certify that the within instrument was filed in this office
for record on the 3 day of Sept, 1982
Robert D. Degen by David B. Armstrong
(COUNTY OFFICIAL) (DEPUTY)