


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Mark A. Fullerton under
General Land Office Contract No. 395 dated
May 25, 1881.

Surveyor General's records state:
South 89°36' East on north bdy sec. 2
40.00 Set basalt stone 14X14X7 in stone mound
for 1/4 sec cor.

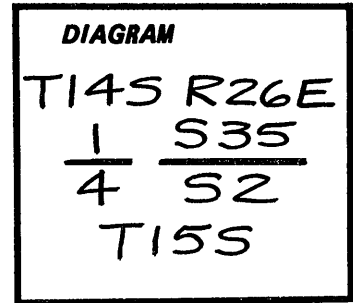

Z-19

Description of corner evidence found:

Found 2 1/2" O.D. galvanized iron pipe 19" above ground with
3 1/4" brass cap set in stone mound 4 ft. diameter. Cap marked
with standard B.L.M. markings. Found a basalt stone 14"X11"X7"
NE of cap in mound with faint markings "1/4". Found new
bearing trees: a 19" dbh Juniper, visible scribing "1/4S35BT",
bears North 8° West, 72.5 ft.; a 10" dbh Juniper, visible
scribing "1/4S2BT", bears South 83° East, 19.7 ft..


**Description of monument and accessories established to perpetuate the
original location of this corner:**

Accepted B.L.M. brass cap as corner monument,
a 2 1/2" O.D. galv. iron pipe 19" above ground
with 3 1/4" brass cap marked as shown:

From which new (B.L.M.-1980) bearing trees:
a 19" dbh Juniper bears North 8° West, 72.5 ft.
with visible scribing 1/4S35BT;
a 10" dbh Juniper bears South 83° East, 19.7 ft.
with visible scribing 1/4S2BT.

Raised and rebuilt stone mound 4 foot base to top of cap
and buried the original stone north of cap.
Set steel post with sign 54-4 9 ft. west of and facing cap.
Painted 6 inch red band and tagged both bearing trees with
signs 54-3 and 54-4.

I hereby certify the above corner monument was re-established
as herein described on AUGUST 11, 1982.

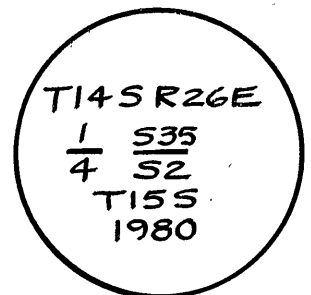

Magnetic
Declination

16° EAST

Office of.....Surveyors..... County of.....Grant.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the.....9..... day of.....Sept....., 19.....82.....
.....Robert H. Dwyer..... by.....
(COUNTY OFFICIAL) (DEPUTY)

