

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


CORNER: W1/4 Cor. Sec. 11, Twp. 14S., R.30E., W.M.

ORIGINAL SURVEY BY: S.W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

Subsequent survey by Grant County Surveyor Robert Baggett in 1990
(See Record Map of Survey NO. 1154)

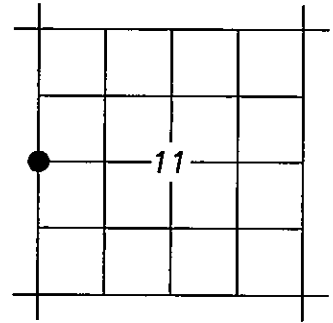

ORIGINAL G.L.O. DESCRIPTION: Set 14x7x4 in mound of stone for 1/4 sec. cor.

County Surveyor's 1990 description: "Found 16"x7"x3" stone marked 1/4 lying in a mound of stones. At the corner point: Set a 1 1/2"x30" galv, iron pipe 12" in the ground with attached Grant County Surveyor brass cap... from which I SCRIBE NEW BEARING TREES: A Juniper 10" diam., bears N.87°E., 18.9 ft. marked 1/4S11 CSBT, A Juniper 10" diam., bears S.38°E., 117.7 ft. marked X CSBT, A Juniper 12" diam., bears S.42°W., 24.3 ft. marked 1/4S10 CSBT, A Juniper 10" diam., bears N.18°W., 24.0 ft. marked X CSBT..."

EVIDENCE FOUND: Found Baggett's 1990 monument in good condition with the mound of stone beginning to spread out. The top of the cap was up about 20 inches above ground. The SE, SW and NW BT's are in very poor health. The NE BT, being in good health with a partially healed blaze and visible scribing, is now 10 1/2" in diam.

DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

At the corner point, we referenced and removed the corner monument. I cut 16" off the pipe and replaced it in its original position. We rebuilt the mound of stone, now 4 ft diam from base to top of cap.

FROM WHICH, I set the following reference points:


A 5/8" x 15" iron pin, driven to bedrock, bears N.40°12'E., 31.23 ft., with attached green plastic cap marked GCS RP..
A 5/8" x 30" iron pin bears S.43°47'W., 39.02 ft., with attached green plastic cap marked GCS RP
A 5/8" x 15" iron pin, driven to bedrock, bears N.46°36'W., 21.55 ft., with attached green plastic cap marked GCS RP....

Bearing to reference points are based on Record Map of Survey No. 2024.

STATE PLANE COORDINATES (3601 ORN)

Reference Datum: NAD83(2011) from an OPUS Solution

Northing: 259,897.7
Easting: 8,572,537.5
Ellip. Ht: 3,803.1

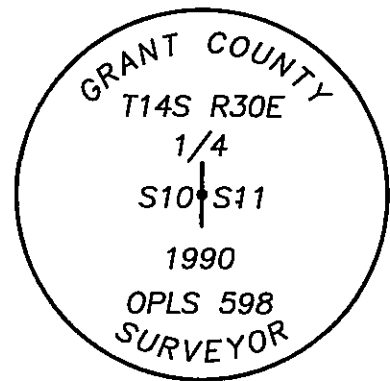

RESTORATION BY:

Michael C. Springer, PLS
Grant County Surveyor
Jason L. Hatfield, PLS
Deputy County Surveyor

217 N. Canyon Blvd.
John Day, OR 97845


Surveyed: March 27, 2015
- Aug. 11, 2015

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

AUG 12 2015

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

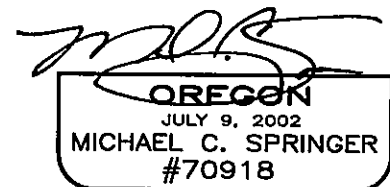

EXPIRES: 6/30/2016