


CORNER RESTORATION

W 1/4 cor.
CORNER Sec 12 TWP 14 S RANGE 30 E
ORIGINAL SURVEY BY: S.W. Lackland
CONTRACT NUMBER: 357
CONTRACT DATE: July 2, 1880

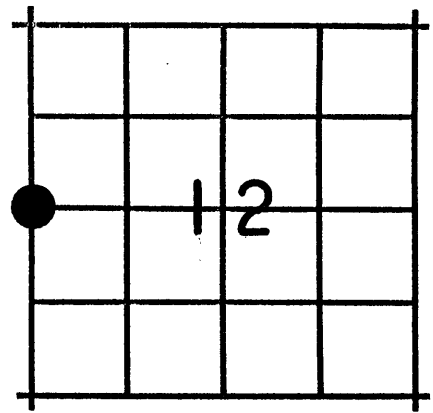



ORIGINAL DESCRIPTION: G.L.O Notes state:
Set stone in mound of stone for 1/4 section corner.
Size of stone 14x12x8.

In June, 1913, Vernon Glaze retraced the west line of Section 12,
recorded in Surveys Record Book 1, page 70, which states:
Set Rock 10"x6" marked 1/4CS=W 1/4 corner Section 12.

Mr. Glaze did not find the original 1/4 corner stone.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
J.L. Watson
K.J. Workman

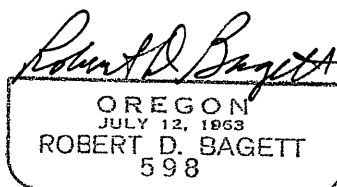

RECEIVED AND
FILED

APR 25 1989

OFFICE OF COUNTY SURVEYOR
Attest: *Robert D. Bagett*

March 13, 1989

EVIDENCE FOUND:

After a diligent search, I found no evidence of
either the original stone or the stone set by Mr. Glaze. Therefore, I
declare this corner lost and establish it by single proportionate
measure between the SW and NW corners of Section 12.

SEE RECORD MAP OF SURVEY NO. 1071

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:


Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a 5/8"x30" iron pin,
with attached 1-1/2" alum. cap, marked as shown:

Raised a mound of stone .3 foot base to top of cap.

No corner accessories taken.

MONUMENT MARKED

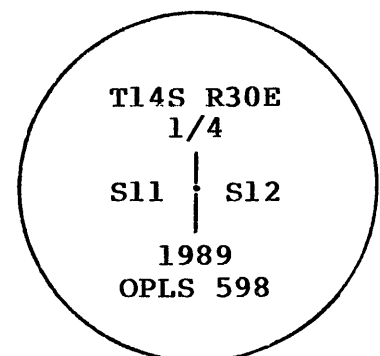

6-21
See Remon Dated April, 1991