


CORNER RESTORATION

CORNER: N1/4 Cor Sec 14, Twp 14 S, Range 30 E, W M

ORIGINAL SURVEY BY: S W Lackland

SURVEY NUMBER. 357

CONTRACT DATE July 2, 1880

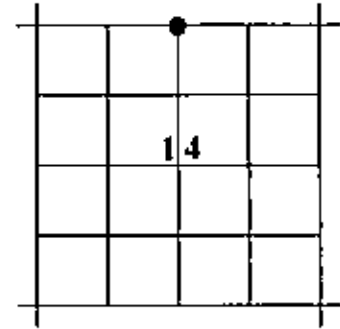

SUBSEQUENT SURVEY

By Robert Bagett, Grant County Surveyor 1990

ORIGINAL G L O DESCRIPTION Set Stone 14x12x8 in mound of stone for 1/4 corner

Bagett's 1990 description: Found 19"x12"x4" stone marked 1/4 lying in a mound of stones


At the corner point I set a 1 1/4"x30" galv iron pipe, 25" in the ground with attached Grant County Surveyor Brass Cap From which I SCRIBE NEW BEARING TRFES: A Juniper 6" diam, bears S6°W, 27.7 ft marked X CSBT A Juniper 22" diam bears S86°W, 20.7 ft marked 1/4S14 CSBT, I also SET NEW REFERENCE POINTS a 5/8"x30" iron pin, bears N55°E, 17.7 ft, with attached alum, cap marked GRANT COUNTY SURVEYOR RP1, a 5/8"x30" iron pin, bears N22°W, 19.4 ft, with attached alum cap marked GRANT COUNTY SURVEYOR RP2

EVIDENCE FOUND. Found Bagett's 1990 monument in place and in good condition I found both BT's healthy with partially healed blazes and visible scribing Also found the two RP's set by Bagett in 1990 in place

STATE PLANE COORDINATES (3601 OR N)

Reference Datum NAD83(2011) from OPUS Solution

Northing 257,234.9 ft
Easting 8,572,539.7 ft
Ellip Ht 3,944.1 ft

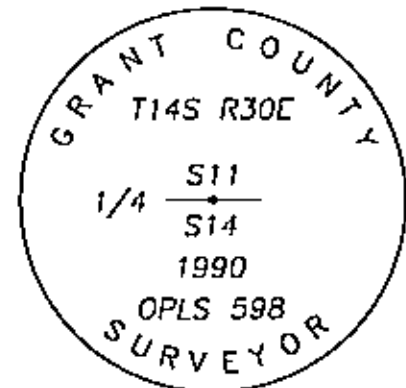

RESTORATION BY, STAMP AND DATE

Michael C Springer, PLS

Grant County Surveyor

May 20, 2011 -

February 8, 2013

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

FEB 8 2013

BY

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C SPRINGER
#70918

EXPIRES 6/30/2014