


CORNER RESTORATION

CORNER: C¼ Sec 2 TWP. 14S. RANGE 31E.

ORIGINAL SURVEY BY: Corner
CONTRACT NUMBER: Not Previously
CONTRACT DATE: Established

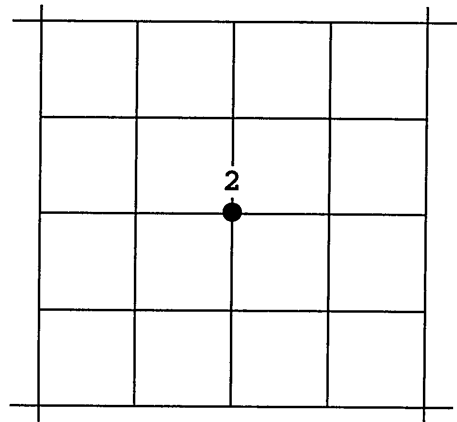

ORIGINAL DESCRIPTION: None.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
S.D. Follweiler
G.J. Russell

RECEIVED AND
FILED

4-6-98

OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST:

G. J. Russell

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

RENEWAL DATE 12/31/99

February 20, 1998

EVIDENCE FOUND: None.

Corner of fences running North, Southeast and West is Northerly 12 ft.
Corner of fences running North, South and Northwest is Northeasterly 16 ft.

See Record Map of Survey No. 1469.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 1½"x30" galv. iron pipe, 30" in the ground, with attached Bagett - Griffith and Blackman brass cap marked as shown.

From Which: I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin, bears N45°E, 23.00 ft., with attached yellow plastic cap marked BGB SURVEY MARKER. Set in north - south fenceline.

A 5/8"x30" iron pin, bears S45°E, 22.00 ft., with attached yellow plastic cap marked BGB SURVEY MARKER. Set in north - south fenceline.

A 5/8"x30" iron pin, bears S45°W, 25.00 ft., with attached yellow plastic cap marked BGB SURVEY MARKER.

A 5/8"x30" iron pin, bears N45°W, 13.00 ft., with attached yellow plastic cap marked BGB SURVEY MARKER. Set in east - west fenceline.

MONUMENT MARKED



Raised a mound of stone 3 ft. base to top of cap. Used mag. compass with 18°E var. and a steel tape.