


CORNER RESTORATION

CORNER: N1/4 CORNER SEC. 17 TWP. 14 S. RANGE 31 E., W.M.

ORIGINAL SURVEY BY: Bamford Robb, Deputy U.S. Surveyor

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

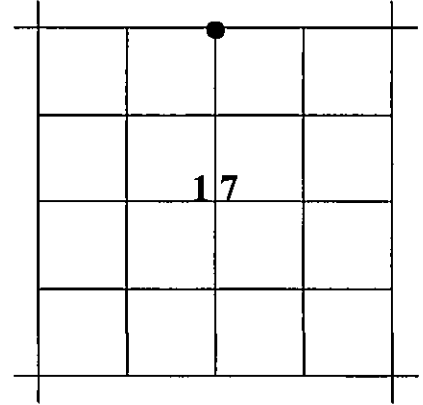

ORIGINAL DESCRIPTION: Set Stone 14X10X8 in mound of stone for 1/4 Sec. cor.

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS



RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JUN 01 2012

BY: 

Benchmark Land Surveying
217 N. Canyon Blvd.
John Day, OR 97845

May 15, 2012

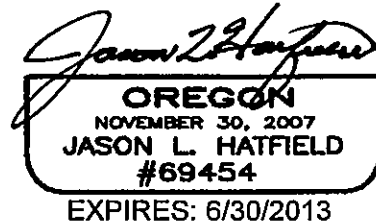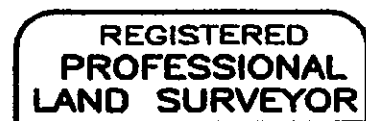

See Record Map of Survey No. 1949

EVIDENCE FOUND: We did not find the original corner stone. I determine this corner to be at the intersection of long established fences extending South and West, which is the best available evidence of the original 1/4 corner position.

DESCRIPTION OF MONUMENT AND ACCESSORIES:


At the corner point, I set a 1½" x30" galvanized iron pipe with attached 2½" brass cap 28" in the ground. Raised a 3 foot diameter mound of stone to top of cap. Brass cap is marked as shown below.

From which, I SET REFERENCE POINTS:

- ▶ A 5/8"x30" iron pin bears N.44°12'E., 28.52 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING"
- ▶ A 5/8"x30" iron pin bears S.44°52'E., 28.46 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING"
- ▶ A 5/8"x30" iron pin bears N.45°11'W., 28.85 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING"

I ALSO SCRIBE A BEARING TREE:

- ▶ A juniper, 19.5" DBH, bears S.05°W., 34.0 ft., marked 1/4 S17 BT.

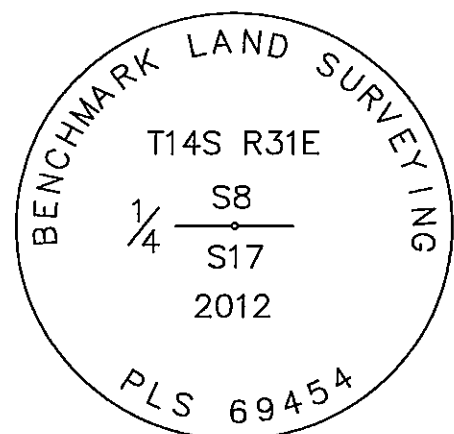

Used RTK GPS to measure RP's. Used a steel tape to measure the distance to the bearing tree, measuring to a 50d nail driven in the side-center at the root crown of the tree. Attached a BT tag to the tree. Bearings are based on Map of Survey No. 1949.