


CORNER RESTORATION

CORNER: SW CORNER SEC. 17 TWP. 14 S. RANGE 31 E., W.M.

ORIGINAL SURVEY BY: Bamford Robb, Deputy U.S. Surveyor

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

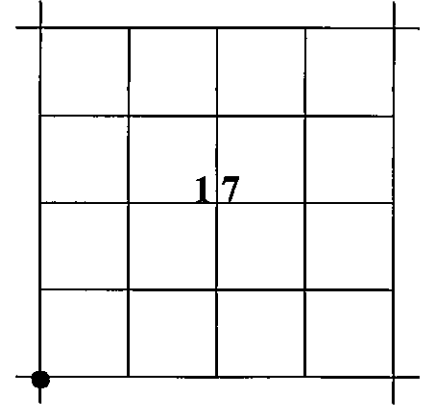

ORIGINAL DESCRIPTION: Set Stone 18X16X12 in mound of stone for cor. to secs. 17, 18, 19 & 20.

RESTORATION BY, STAMP AND DATE:

J.L. Hatfield, PLS


Benchmark Land Surveying
217 N. Canyon Blvd.
John Day, OR 97845

May 16, 2012

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

JUN 01 2012

BY:

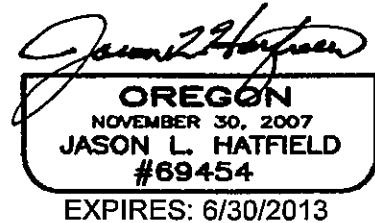

See Record Map of Survey No. 1949

EVIDENCE FOUND: We did not find the original corner stone. This corner is determined to be at an ancient fence intersection with fences extending North, East, South and West, which is the best available evidence of the original section corner position.

DESCRIPTION OF MONUMENT AND ACCESSORIES:

At the corner point, I set a 1½"x30" galvanized iron pipe with attached 2½" brass cap 28" in the ground. Raised a 2 foot diameter mound of stone to top of cap. Brass cap is marked as shown below.

From which, I SET REFERENCE POINTS:

- ▶ A 5/8"x30" iron pin bears N.05°02'E., 24.96 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING" in a north-south fence.
- ▶ A 5/8"x30" iron pin bears N.89°07'E., 34.99 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING" in an east-west fence.
- ▶ A 5/8"x30" iron pin bears S.00°31'W., 29.73 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING" in a north-south fence.
- ▶ A 5/8"x30" iron pin bears N.88°46'W., 37.07 ft., with attached yellow plastic cap marked "BENCHMARK SURVEYING" in an east-west fence.



Used RTK GPS to measure RP's. Bearings are based on Map of Survey No. 1949.