


CORNER RESTORATION

S. W. Cor.
CORNER Sec. 35 TWP 14S. RANGE 31 E. W.M.

ORIGINAL SURVEY BY: Bamford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

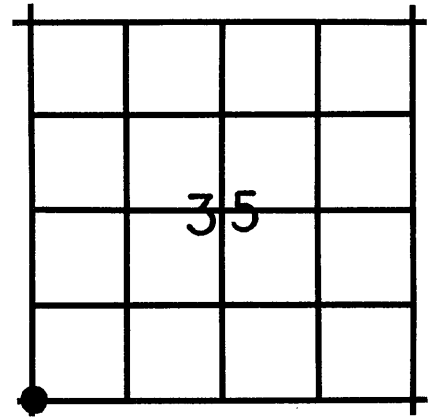

ORIGINAL DESCRIPTION:

S. 89° 54' W. on a true line between Secs. 2 & 35.

35.00 Brook 2 lks. wide flows S.E.

80.00 set stone 12x8x6 for cor. to Secs. 2, 3, 34, 35, from which:

A pine 20" in diam. bears S. 68° E. 46 lks. dist.

A pine 18" in diam. bears N. 78° E. 56 lks. dist.

A pine 16" in diam. bears S. 60° W. 77 lks. dist.

A pine 7" in diam. bears N. 45° W. 92 lks. dist.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
S. L. Crane

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

RECEIVED AND
FILED

NOV 25 1977

John Liveira
JOHN LIVEIRA, County Clerk

By _____ Deputy

September 20, 1977

Grant County Surveyor

EVIDENCE FOUND:

I found unmarked stone of called size (12x8x6) in mound of stone 5' South of E-W fence line, from which:

Orig. B.T.'s

A 27" pine bears S. 75° E. 30.4 feet, marked S. 2 T 15 in partially opened blaze.

A 24" pine bears N. 88° E. 35.8 feet, marked S 25 n partially opened blaze.

A 35" pine bears S. 60° W. 56.2 feet, marked S 3 T 15 R 31 E in partially opened blaze.

A 21" pine bears N. 53° W. 59.9 feet, not marked, blaze healed. Tree is not marked.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point, I set a 1½" x 30" iron pipe 20" in the ground in a mound of stone with brass cap marked as shown.

The original B.T.s are alive and in good condition, so I did not scribe new B.T.'s.

I used a compass with a 20° East variation and steel tape, measuring to the center of the original B.T.'s.

Corner is 5' South of East-West fenceline.

See Map of Survey No. 467.

MONUMENT MARKED

