

CORNER RESTORATION


CORNER: N1/4 Sec 6 TWP 14S. RANGE 32E.

ORIGINAL SURVEY BY: S.W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

Subsequently resurveyed & monumented by Robert D. Bagett, County Surveyor, June 29, 1984, See corner restoration records.

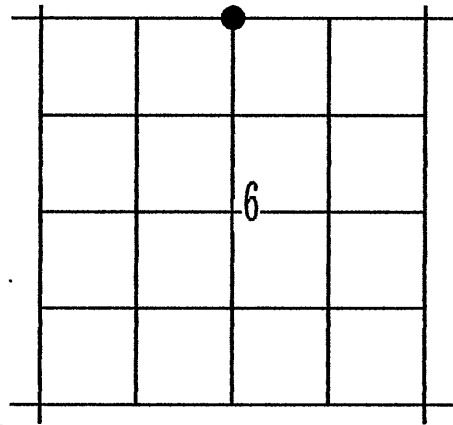

ORIGINAL DESCRIPTION: S.W. Lackland, U.S. Deputy Surveyor, originally subdivided this township. He did not set the North $\frac{1}{4}$ corner of Sec. 6. In 1906, Joseph Reese, U.S. Deputy Mineral Surveyor, established this corner in Mineral Survey No. 626. Reese's record states: A granite rock 6x12x24 ins. set 12 ins. in the ground in mound of rock, chiseled 1-626 B.P.C. on South face.

I found original evidence in 1984, my record states:
At the corner point: Set a 2 inch i.d.x 30 inch galvanized iron pipe with $2\frac{1}{2}$ inch brass cap attached marked as shown, 28 ins. in the ground:
from which:

I scribe NEW BEARING TREES:

A Juniper 14 ins. diam., bears S. $30\frac{1}{2}^{\circ}$ E., 44.1 ft., mkd. T14S R32E $\frac{1}{4}$ S6 BT.
A Juniper 4 ins. diam., bears S. 33° W., 118.1 ft., mkd. X BT.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED

MAR 2, 1995
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST: *G. J. Russell*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1983
ROBERT D. BAGETT
598

Renewal Date 12/31/95

February 27, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a $2\frac{1}{2}$ " iron pipe with attached $2\frac{1}{2}$ " brass cap, marked as shown below, set in a mound of stone.

From which:

A Juniper 14"diam., bears S $30\frac{1}{2}^{\circ}$ E, 44.1 ft. with partially healed over blaze, scibing visible.

A Juniper 5"diam., bears S 33° W, 118.1 ft. with partially healed over blaze, scibing visible.

Measured to 40d nail driven flush in the face of the blaze.

Corner is 1' south of fence running East and West.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

The monument set in 1984 is in good condition.

I add the marks "GRANT COUNTY SURVEYOR 1995" to the brass cap monument.

From which: I SET NEW REFERENCE POINTS:

A $\frac{5}{8}$ "x30" iron pin, bears N 45° E, 20.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 1995 OPLS 598.

A $\frac{5}{8}$ "x30" iron pin, bears N 45° W, 20.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 1995 OPLS 598.

MONUMENT MARKED

T13S R31E

$\frac{1}{4}$ S6

T14S R32E

1984

OPLS 598

Repaired mound of stone 3 ft. base to top of cap. Used mag. compass with 20° E var. and a steel tape, Attached BT tags to BT's.