

RECEIVED AND
FILED

FEB 6 1973

JOHN LIVEIRA, County Clerk

CORNER RESTORATION


By _____ Deputy

$\frac{1}{4}$ CORNER 3/2 TWP 11S. RANGE 32 EWM

ORIGINAL SURVEY BY: S.W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

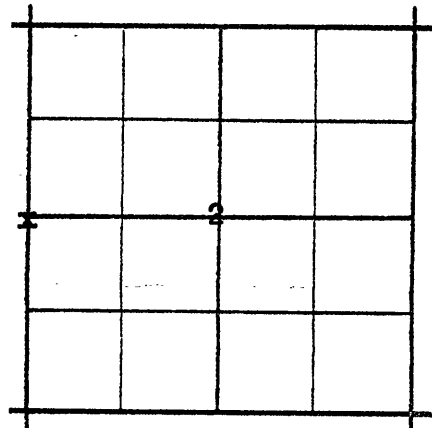

ORIGINAL DESCRIPTION:

Set stone 1 1/4 x 1 1/2 in mound of stone for $\frac{1}{4}$ cor. from which

A pine 40 in. dia. bears N. 82° E. 50 lks. dist.

A pine 10 in. dia. bears S. 87° W. 200 lks. dist.

RESTORATION BY, STAMP AND DATE:

Corner restored Oct. 14, 1972
by:


RALPH THOMPSON

REGISTERED LAND SURVEYOR

P. O. BOX 1082 PENDLETON, ORE. 97801



Ralph P. Thompson

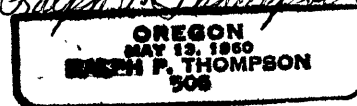

EVIDENCE FOUND:

4 1/2" pine stump at intersection of fences E-W-N. with scribbing visible all other evidence apparently destroyed by cat road.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

Reversed bearing and distance from 4 1/2" pine stump & set a 1 1/4" x 3/8" iron pipe with 2" brass cap marked as shown, 30 in. in ground and raised a mound of stones around it for $\frac{1}{4}$ cor. bet. sections 3 & 2. **MONUMENT MARKED**

From which new BT's

A 8" pine bears S. 86° 30' E. 56.5 ft. dist. scribed $\frac{1}{4}$ S. BT.

A 6" Juniper bears N. 5° 40' W. 3.4 ft. dist. scribed $\frac{1}{4}$ S. BT.

All distances taken to face of blaze.

Used steel tape & magnetic compass with dec. = 21° E.

Checked angles with T-2 theodolite to verify bearings.

Complete and File with Office of the Grant

County Surveyor, Grant County, Oregon,

Courthouse, Canyon City, Oregon 97820

