

CORNER RESTORATION


Sec. 1

CORNER E. 1/16 Cor. TWP T14S RANGE R32W

ORIGINAL SURVEY BY:

CONTRACT NUMBER:

CONTRACT DATE:

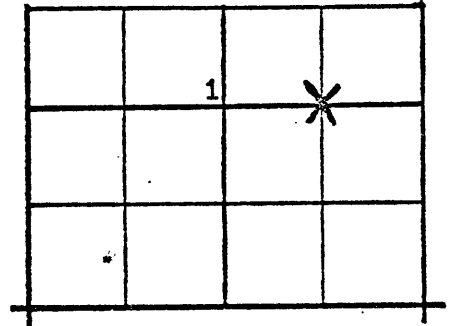


ORIGINAL DESCRIPTION:
No original corner set.

**RECEIVED AND
FILED**

DEC 22 1976
John Liveira
JOHN LIVEIRA, County Clerk

By _____ Deputy

RESTORATION BY, STAMP AND DATE:

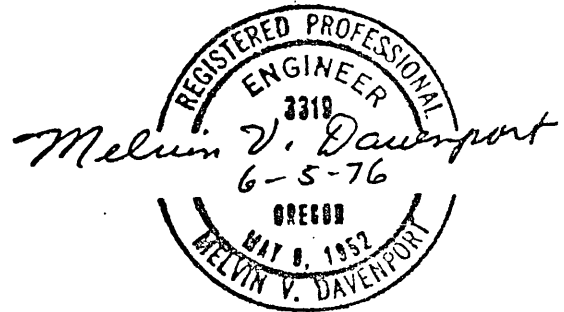

June 5, 1976

EVIDENCE FOUND:

No evidence.

This corner set by single proportionate measure between the center 1/4 corner Sec. 1 and the 1/4 corner between Sec. 1 and Sec. 6, T14S R32E and R33E W.M.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a stem monument in concrete 4" above the ground. Placed a

Rebar 1/2"x18" under the monument 5" under the ground level.

The Brass stem monument is marked as shown.

From which I scribe NEW BEARING TREES:

A pine 7" diam., bears **N12°W** 47.6 ft., mkd.

CE1/16 S1 BT.

A juniper 15" diam., bears **S71°W** 56.2 ft., mkd.

CE1/16 S1 BT.

These trees were scribed and tagged by the G.C.S.

I surrounded corner with mound of stone. I used a compass

with a 20° east variation and steel tape measuring

Complete and File with Office of the Grant to the face of BT

County Surveyor, Grant County, Oregon, blaze.

Courthouse, Canyon City, Oregon 97820

MONUMENT MARKED

