


CORNER RESTORATION

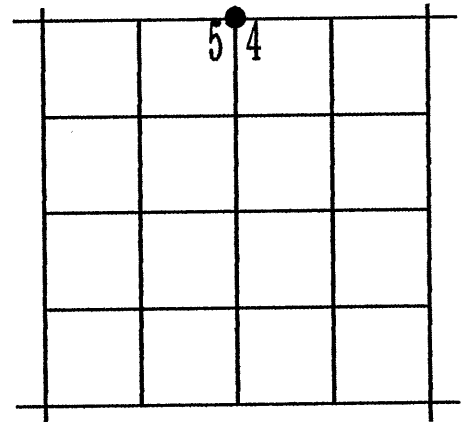

CORNER: Closing Secs. 4&5 TWP 14S. RANGE 33E.

ORIGINAL SURVEY BY: Banford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

Subsequently remonumented by Douglas M. Ferguson, Deputy County Surveyor, May 15, 1971, See corner restoration records.

ORIGINAL DESCRIPTION: Intersected Township boundary 47.04 chs. west of established cor. to secs. 32 and 33 at which point I set a basalt stone 16x12x8 in a stone mound for closing cor. to secs. 4 & 5.

Ferguson found the original stone in 1971, his record states:

Set 1½"x36" iron pipe 24 ins. in the ground with brass cap marked as shown. (marks shown below).

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
J.L. Watson
G.J. Russell
S.D. Follweiler

RECEIVED AND
FILED

APRIL 21, 1995
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
Attest: Steven D. Follweiler

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1983
ROBERT D. BAGETT
598
Renewal Date 12/31/95

March 9, 1995

Grant County Surveyor

EVIDENCE FOUND: Found a 1½" iron pipe with a 2½" Grant County Surveyor brass cap marked as shown below, set in a mound of stone.

Corner is 6' southeast of corner of fences running East, South and, West.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

The monument set in 1971 is in good condition.

MONUMENT MARKED

From which: I SET NEW REFERENCE POINTS:

A 5/8"x30" iron pin, bears N80°E, 20.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 1 1995 OPLS 598.
A 5/8"x30" iron pin, bears S38°E, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 2 1995 OPLS 598.
A 5/8"x30" iron pin, bears S9°W, 25.00 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 3 1995 OPLS 598.
A 5/8"x30" iron pin, bears N35°W, 4.29 ft., with attached alum. cap marked GRANT COUNTY SURVEYOR RP 4 1995 OPLS 598. (set in corner of fences running E-S-W).

GRANT COUNTY
SURVEYOR

T13S R33E

S32

S5 | S4

T14S R33E

CC

LS 848

1971

Repaired mound of stone 3 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape.