


CORNER RESTORATION

SE Cor.
CORNER Sec. 17 TWP 14S RANGE 34E

ORIGINAL SURVEY BY: S. W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

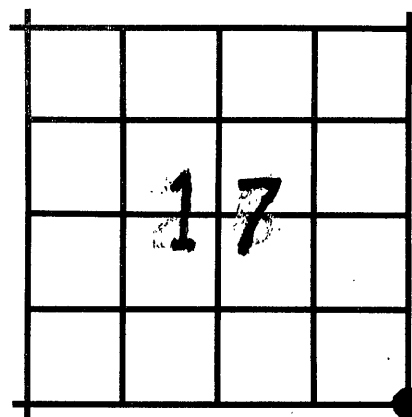

ORIGINAL DESCRIPTION:

East 80.00 set stone 16"x12"x10" in mound of stone for cor. to Secs. 16, 17, 20 and 21, from which:

- A pine 12" in diam. bears N. 85° W., 21 lks. dist.
- A pine 20" in diam. bears N. 30° E., 82 lks. dist.
- A fir 6" in diam. bears S. 2° W., 30 lks. dist.
- A fir 8" in diam. bears S. 85° E., 26 lks. dist.

RECEIVED AND
FILED

JUN 24 1977

RESTORATION BY, STAMP AND DATE

R. D. Baggett
W. Gentis

REGISTERED
PROFESSIONAL
LAND SURVEYOR

JOHN LIVEIRA, County Clerk
Betty Lowery Deputy

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 26, 1977

Grant County Surveyor.

EVIDENCE FOUND:

I did not find the original corner stone, however, I did find 4 original BT's. I establish corner point at record distance from these trees as the bearings would not fit.
OLD BT's:

- A 20" pine stump bears N. 22° E., 54.12 feet marked BT.
- A dead and down 12" fir bears S. 86° E., 17.16 feet. Marks have been chopped from this tree.
- A live fir 24" in diam. brs. S. 3° E., 19.80 feet, blaze closed did not open.
- A pine snag 18" in diam. brs. N. 60° W., 13.86 feet, marked T14 R34.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.


At the corner point, I set a 1½"x30" iron pipe 26" in the ground in a mound of stone with brass cap marked as shown.
From which I scribe New BT's.

- A fir 14" in diam. brs. N. 85° W., 58.0 ft. marked T14SR34ES17CSBT.
- A fir 6" in diam. brs. N. 21° E., 24.6 ft. marked T14SR34ES16CSBT.

I used a compass with 20° East variation and steel tape, measuring to face of blaze on BTs.

Corner is 6 feet South of East-West fenceline.

MONUMENT MARKED

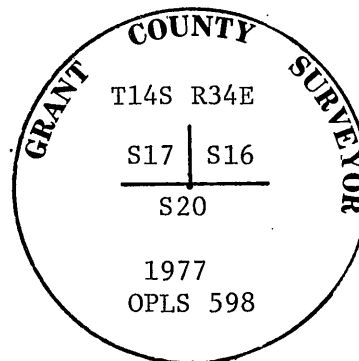

N-9 SC