

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was established by S.W. Lackland & Bamford Robb, US Deputy Surveyors, during the original survey Joint Contract No. 357 dated July, 1880.

Set stone 18x12x8 in mound of stone for cor to secs 13 & 24

DIAGRAM

T14S	
R34E	R35E
S13	S18
S24	S19

1991
PLS 699

Description of corner evidence found:

Found the marked stone on the south side of a large mound of stone.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2"x30" aluminum pipe with a 2½" aluminum cap, marked as shown in the diagram, 28" in the ground, replacing the rock which is turned upside down and buried on the south side of the monument. The mound needed no improvement and was found to be 36" in diameter by 24" high North of the monument, from which new BTs and Accessories are:

36" Ponderosa pine bears S66°W, 146.4 feet scribed T14SR34E S24 BT

A Pink DEEP bears N66°E, 3.9 feet buried 6" in the ground

A 16x24x30 rock outcrop bears S88°30'E, 174.5 feet chiseled with "X" on top and "B0" on SW face

A 18x24x28 rock outcrop bears N71°15'W, 272.0 feet chiseled with "X" on top and "B0" on E face

Attached BT and an Attention signs to and painted a red band around each BT. Bearings were turned from the control traverse with a theodolite, basis of bearing being a solar observation that was made on the adjacent McCoy Cadastral Survey contract in 1987, to stamped aluminum washers nailed on new BTs in the scribed red-painted blazes or to the red-painted blazes or scars on old BTs. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground.

Set steel fence posts 4.3 feet N, 5.1 feet E, 4.3 feet S and 4.8 feet W of the corner on the National Forest boundary lines. Attached Forest Boundary signs to each post and an Attention sign to the N post.

I, Leland L. Myers, 587 E. Auburn St., P.O. Box 98, Sumpter, OR 97877, do hereby certify that on October 25, 1991, I monumented the corner as herein described.


FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR

THIS 30 DAY OF NOV, 19 92

Robert R. Baggett

Grant County Surveyor

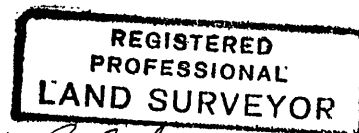

MAP OF SURVEY No. 1197