


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Samuel W. Lackland, Deputy Surveyor, under G.L.O. Contract No. 384 dated March 29, 1881.

Surveyor General's records state:

S89°48'W on true line between Secs 12 & 13  
39.96 Set stone 16X12X6in mound of stone for 1/4 Sec. Cor.

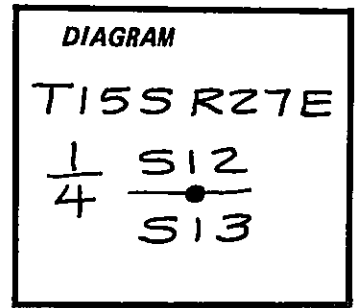

J-23  
F.B.2 Pgs.13&14

Description of corner evidence found:

At assumed corner location made a thorough search for original corner monument but found no evidence. Corner falls on very steep North slope with scattered stones, found no stone mounds nor marked stones. I consider corner lost and re-establish by single proportionate method by survey.

Description of monument and accessories I established to perpetuate the original location of this corner:

At single proportionate position as determined by survey, set 2-1/2 inch O.D. X 30 inches long aluminum pipe 18 inches in ground to bedrock with 3 inch aluminum cap marked as shown:

Marked bearing trees:


A 16" Ponderosa Pine bears South 65-1/2° East, 124.2 ft., scribed-1/4S13BT;

A 10" Juniper bears North 8-1/2° West, 62.0 ft., scribed-1/4S12BT.

Raised stone mound 2-1/2 feet diam. to cap. Set steel post 5 feet South with sign 54-4 facing cap. Painted red band and faces red and nailed signs 54-3 and 54-4 to BT's. Nailed brass washer stamped "AS&E LS1026" to face of BT's.

I hereby certify that the above corner monument was re-established as herein described on May 20, 1987.

Witnesses: David B. Armstrong  
Shelby H. Griggs

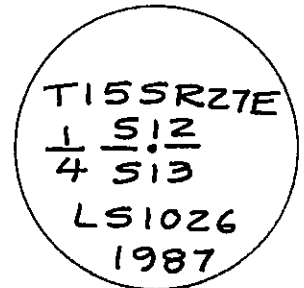

M.V.19-1/2°E.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*David B. Armstrong*

6/26/87 OREGON  
AUGUST 22, 1973  
DAVID B ARMSTRONG  
1026

Office of... *Surveyor* ..... County of... *Grant* .....  
State of... *Oregon* ..... I hereby certify that the within instrument was filed in this office  
for record on the... *6*... day of... *Aug* ..... 19... *87* .....  
*Robert H. Griggs* ..... by .....  
(COUNTY OFFICIAL) (DEPUTY)