


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Samuel W. Lackland, Deputy Surveyor, under G.L.O. Contract No. 384 dated March 29, 1881. Surveyor General's records state: North between Secs 13 & 14 40.00 Set basalt stone 16X16X4 in mound of stone for 1/4 Sec Cor.

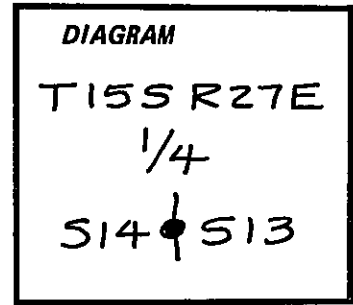

L-21
F.B.2 Pgs.15&16

Description of corner evidence found:

At assumed corner location made a thorough search for original monument with no success. Found no stone mounds and no stones record size in immediate search area. Area has a large amount of surface stone but is undisturbed. Search for not found. I consider corner is lost and re-establish by survey at single proportionate position.

Description of monument and accessories I established to perpetuate the original location of this corner:

At single proportionate position as determined by survey, set 2-1/2 inch O.D. X 30 inches long aluminum pipe 15 inches in ground to bedrock with 3 inch aluminum cap marked as shown:


Marked bearing trees:

An 8" Juniper bears South 37-1/2° East, 16.1 ft., scribed-1/4S13BT;
A 21" Juniper bears South 60° West, 17.5 ft., scribed-1/4S14BT.

Raised stone mound 4 foot diam. to cap. Set steel post 3 feet North with sign 54-4 facing cap. Painted red band and faces red and nailed signs 54-3 and 54-4 to BT's. Nailed brass washer stamped "AS&E LS1026" to face of BT's.

I hereby certify that the above corner monument was re-established as herein described on May 20, 1987.

Witnesses: David B. Armstrong

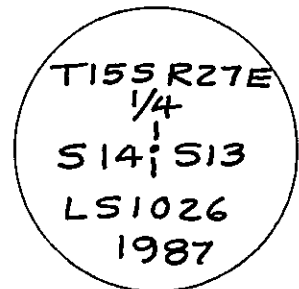

M.V.19-1/2°E.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David B. Armstrong

6/26/87 OREGON
AUGUST 22, 1973
DAVID B. ARMSTRONG
1026

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 6 day of Aug, 1987
Robert D. Bazzett by _____
(COUNTY OFFICIAL) (DEPUTY)