

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by S.W. Lackland under joint contract number 357 dated July 2, 1880.

Page 29 of the government field notes state:

40.00 Set post for 1/4 sec. cor. from which

A pine 10 in dia bears S45°E 35 lks dist.
" " 24 " " " N75°W 22 " "

No record of subsequent remonumentation found in county records.

Description of corner evidence found:

I did not find the original corner post.

I re-establish the corner point from the original bearing tree. From the corner point:

A 23" DBH PP stump 5 ft. tall bears N75°W 22 lks. scribed 1/4S BT.

No evidence of other BT as it falls where equipment has been operated.

Description of monument and accessories I established to perpetuate the original location of this corner:


Set a 30" long 2-1/2" dia. aluminum pipe with 3-1/4" cap marked:

24" in ground & erected a mound of stones around it.

from which I scribe NEW BEARING TREES:

A 22" DBH Doug Fir bears S32°E 27.7 Ft., scribed 1/4 S15 BT.

A 22" DBH Doug Fir bears S42°W 43.6 Ft., scribed 1/4 S16 BT.

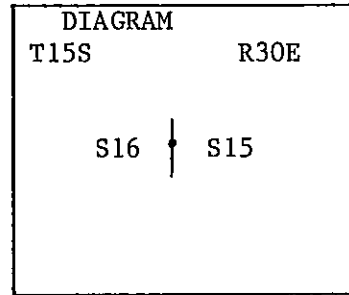

U.S. DEPT.
OF AGRICULTURE
UNLAWFUL TO DISTURB

T15S
R30E
1/4
S16 | S15

OPLS 1805
1979
CADASTRAL SURVEY
FOREST SERVICE

Painted faces & bands around BT's red & attached BT & Attention tags.

Drove a 6 Ft. long steel fence post 2.0 Ft. in ground 6 Ft. North of corner & attached an attention tag to it.

Used steel tape & magnetic staff compass with 20° East variation, measuring to the center of the new BT's.

This corner was set August 31, 1979.

Witness: F.R. Palmer & S. Anderson

Office of _____ County Surveyor _____ County of _____ Grant _____
State of Oregon, I hereby certify that the within instrument was filed
in this office for record on the 4 day of Feb, 1980
Robert D. Bayitt by _____
(COUNTY OFFICIAL) (DEPUTY)

*Supersedes remon. sheet filed by
Calkins 12-6-79.*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 13, 1979
F. E. CALKINS
1805