


CORNER RESTORATION

N.W. Sec. Cor.
CORNER Sec. 36 **TWP** 15S **RANGE** 30E

ORIGINAL SURVEY BY: S. W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

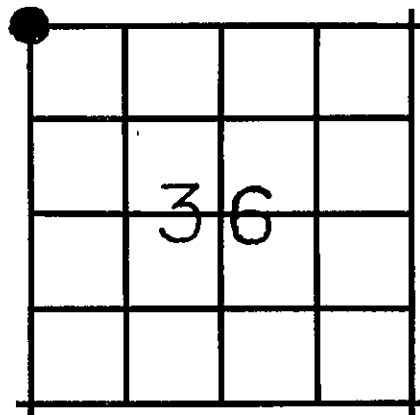

ORIGINAL DESCRIPTION:

80.00 set post for cor. to Secs. 25, 26, 35 and 36, from which:

- A pine 24" in diam. brs. N. 50° E., 10 lks.
- A pine 48" in diam. brs. S. 45° E., 110 lks.
- A pine 20" in diam. brs. S. 35° W., 167 lks.
- A pine 30" in diam. brs. N. 40° W., 10 lks.

**RECEIVED AND
FILED**

JUN 24 1977

JOHN LIVEIRA, County Clerk

Betty Lowery Deputy

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
 W. Gentis

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

December, 1976

Grant County Surveyor

EVIDENCE FOUND:

At the corner point I found a 1½"x30" iron pin set at record distance from two remaining original BT's. This pin was set by James D. Hanley (R.P.E. No. 2808) See Map of Survey No. 449, from which OLD BT's:

- A pine stump 54" in diam. brs. S. 50° E., 72.6 ft. mkd. S36T15.
- A pine snag 48" in diam. Brs. S. 80° E., 6.6 ft. faint scribing visible.

The bearing to these BTs does not fit original description, so I used record distance. I accept this position.


DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point I set a 1½"x30" iron pipe 26" in the ground with brass cap mkd. as shown. Buried iron pin East and alongside brass cap, from which I scribe NEW BT's:

MONUMENT MARKED

- A pine 5" in diam. brs. N. 77° E., 49.7 ft. mkd. X BT
- A pine 9" in diam. brs. S. 54° E., 65.2 ft. mkd. T15SR30ES36CSBT
- A pine 9" in diam. brs. S. 57° W., 61.8 ft. mkd. T15SR30ES35 CSBT.
- A pine 16" in diam. brs. N. 24° W., 115.8 ft. mkd. T15SR30ES26 CSBT.

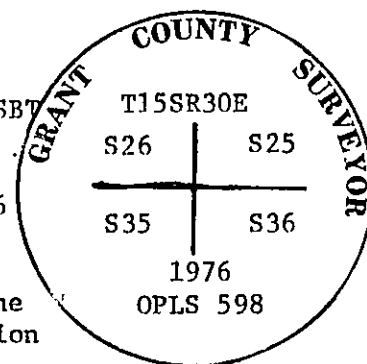

Section corner is approximately 80 ft. South of the center line of the Izee County Road. I used compass with 20° East variation and steel tape measuring to face of blaze on BT's.