

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was established by A. O. Eckelson, US Deputy Surveyor, during the original survey Joint Contract No. 328 dated June, 1879.

Set post for corner to Secs 33 & 34 in mound of Earth with charred stake pits as per instructions from which

A pine 28 ins diam bears N89°E, (110.2') 167 lks dist

DIAGRAM
S C
T15S R30E

S33 | S34

S 3
T16S
1986
PLS 699

Description of corner evidence found:

11x10x6 sandstone with 6 clear chisel marks on S face & 3 on E edge at the proper distance & bearing from accepted BT. The stone was not called for in the original notes, but is clearly marked. It also falls at the intersection of two old fences. Therefore, the stone was accepted as the standard corner between Sections 33 & 34.

36" Ponderosa pine (6' Stump) (No Scribing Was Visible on Blaze) (1879 BT) bears S88° 30'E, 112.0 feet Survey found BT & stone to be in the proper location. Found a very distinctive notch "Λ" at the base of the blaze.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2"x30" aluminum pipe with a 3 1/4" aluminum cap, marked as shown in the diagram, 26" in the ground, replacing the rock which is turned upside down and buried on the north side of the monument. Built a mound of earth & rock to be 24" in diameter by 4" high around the monument.

No new bearing trees set because no trees are within the allowable limits to the north. Trees to south are in winter feed lot and are badly damaged.

1"x30" galv. pipe with 2 1/2" alum. cap Reference Monument bears N41°E, 11.6 feet marked RM 11.6' 1986 PLS 699 set in a fence line to the N


1"x30" galv. pipe with 2 1/2" alum. cap Reference Monument bears N51°W, 8.2 feet marked RM 8.2' 1986 PLS 699

Attached BT and Attention signs to and painted a red band around each BT. Bearings were taken with a staff compass, using a declination of 18° 30'E, to stamped brass washers nailed in the scribed red-painted blazes.

Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground.

Set a steel fence post 5 feet S of the corner with an Attention sign attached. The monument is not a National Forest property corner.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on May 20, 1986, I monumented the corner as herein described.

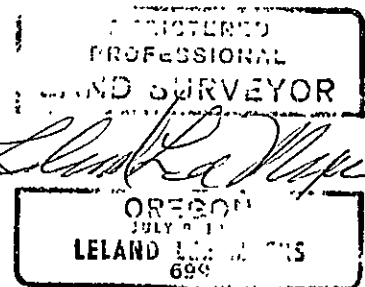

FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR

THIS 20 DAY OF June, 1986

Robert D. Bassett
Grant County Surveyor