


CORNER RESTORATION

SE 1/16 Cor
CORNER Sec. 11 TWP 15 S RANGE 31 E

ORIGINAL SURVEY BY:

CONTRACT NUMBER:

CONTRACT DATE:

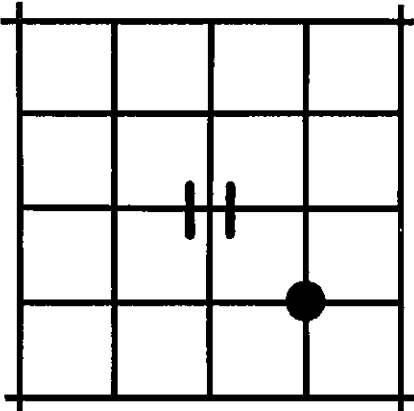


ORIGINAL DESCRIPTION:

No previous monument established of record.

RESTORATION BY, STAMP AND DATE:


R. D. Bagett
J. L. Watson
Mart Taylor



RECEIVED AND
FILED

OCT 12 1989

August 31, 1989

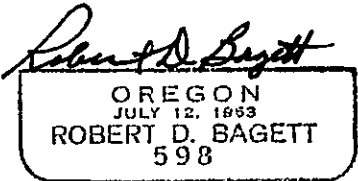

EVIDENCE FOUND: None.

See Record Map of Survey No. 1105

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the intersection of the E-W 1/16th line and the N-S 1/16th line, I set a 2 1/2"x30" galvanized iron pipe, 30" in the ground, with attached brass cap marked as shown, from which I scribe New Bearing Trees:

A Juniper 6" diam. bears S. 49° E., 47.9 feet marked SE 1/16 S11 BT.

A P. Pine 17" diam. bears N. 34° E., 128.7 feet marked SE 1/16 S11 BT.

Raised a mound of stone to top of cap. Used Magnetic Compass with a 20° E. variation and steel tape. I measured to a 50d nail driven in the side center at the root crown of the BTs. I attached B-G-A tags and painted blazes with red timber marking paint.

MONUMENT MARKED

