


CORNER RESTORATION

E. $\frac{1}{4}$ cor.
CORNER Sec 13 TWP 15S. RANGE 31E.

ORIGINAL SURVEY BY: Banford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

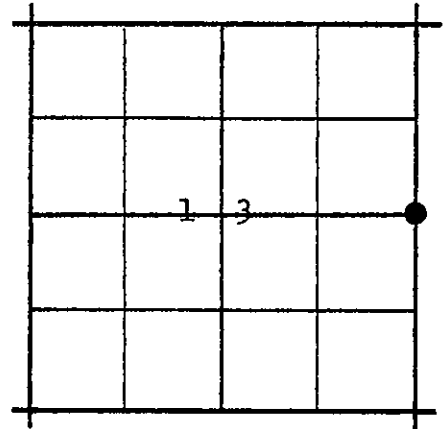

ORIGINAL DESCRIPTION:

40.00-set stone 12"x8"x6" for the $\frac{1}{4}$ cor. between Sections 13 & 18
From which,

a pine 20" in dia. bears S40°W, 33 Lks. dist.

a pine 30" in dia. bears S80°E, 71 Lks. dist.

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

RECEIVED AND
FILED

OCT 16 1972
JOHN LIVEIRA, County Clerk

By _____ Deputy

September 23, 1972

EVIDENCE FOUND:

$\frac{1}{4}$ marked on stone of call size firmly set in a mound of stone.

From which ORIGINAL BEARING TREES,

a 20" pine stump bears S67°E, 44.5 feet, marked $\frac{1}{4}$ B.T. with chaining notch. (Record = 30" Pine bears S80°E, 71 Lks.)

A 30" decaying Pine stump with axe marks visible bears S30°W, 22.1 ft.
(Record = a 30" pine bears S40°W, 33 Lks.)

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

Set 1 $\frac{1}{2}$ "x30" galvanized iron pipe 12" in ground at original stone with brass cap marked as shown and surrounded it with a mound of stone.

Set original stone South and along side of the pipe. MONUMENT MARKED

From which NEW BEARING TREES,

A 7" pine bears S56°W., 35.9 feet marked $\frac{1}{4}$ S.13 C.S. B.T.

A 7" pine bears S58°E., 45.5 feet marked $\frac{1}{4}$ S.18 C.S.B.T.

Measured Horizontal dist. to blaze on B.Ts. from the brass cap.

Complete and File with Office of the Grant Comp. Var. 20°
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

