


CORNER RESTORATION

1917 H.E.S. No. 217
CORNER No. 7 TWP 15S RANGE 32E

ORIGINAL SURVEY BY: W.M.H. Woodward

CONTRACT NUMBER: H.E.S. No. 217

CONTRACT DATE: Feb. 24, 1917

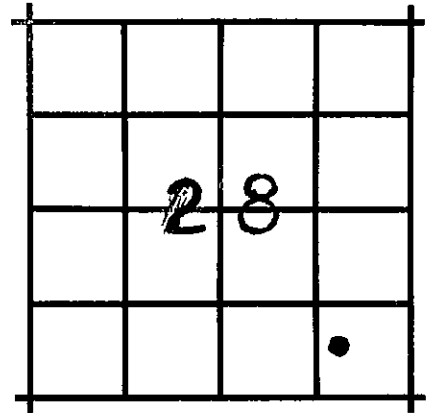

ORIGINAL DESCRIPTION:

30.45 angle point 210 ft. above Cor. no. 6 and point for Cor. No. 7 of this survey, which I establish as follows: Set a sandstone 24x12x10 ins., 6 inches in the ground on solid bedrock in a mound of stone, over broken glass for cor. no. 7 of this survey, marked with a cross (X) on top for exact cor. point and 7 HES 217 on side facing claim, from which:

A pine 36" in diam. bears S. 51° 15' E., 75 lks. dist. mkd. X7HES217BT

A pine 4" in diam. bears S. 66° 15' W., 41 lks. dist. mkd. X7HES217BT

Raise a mound of stone, 3 ft. base, 1½ ft. high, 3½ ft. dist. S of corner.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
W. Gentis

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1903
ROBERT D. BAGETT
598

Feb. 24, 1976

Grant County Surveyor

EVIDENCE FOUND:

Found original 1917 H.E.S. No. 217 corner no. 7, which is a stone 24"x12"x10" marked 7HES 217 firmly set. From which: (Old BT's) measured to center of BT's:

A 28" pine snag brs. S. 51° E., 48.5 ft. dist. mkd. X7HES217.

A 19" pine brs. S. 66° W. 27.3 ft. dist. with scribing blaze completely healed. I did not open this tree.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:


Show how trees are scribed and basis of bearings, including compass var.

MONUMENT MARKED

At corner point and under X on original H.E.S. cor. stone I set a 5/8"x30" iron pin 30" in ground and replaced original corner stone over top of pin. I scribe NEW BT:

A 7" in diam. juniper brs. S. 31° E., 31.6 ft. dist. mkd. HES7CSBT.

I used a compass with a 20° East variation and a steel tape, measuring to face of blaze on new BT.

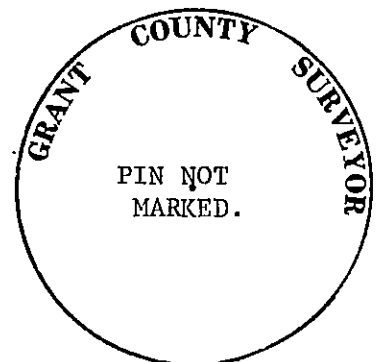

RECEIVED AND
FILED

DEC 20 1976
John Liveira
JOHN LIVEIRA, County Clerk
By _____ Deputy