


CORNER RESTORATION

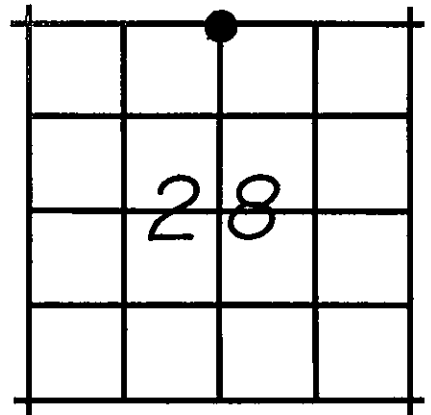

N. 1/4 Cor.
CORNER Sec. 28 TWP 15 S. RANGE 32 E.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 384

CONTRACT DATE: Mar. 29, 1881

RETRACEMENT: W.M.H. Woodward
H.E.S. 217
Feb. 24, 1917

ORIGINAL DESCRIPTION:

39.81 Set basalt stone 20 x 7 x 4 in mound of stone for 1/4 Sec. Cor.
1917 RETRACEMENT: North on random line through the center of Sec. 28. (80.39) fall 26 lks. W. of the 1/4 Sec. Cor. between Secs. 21 and 28, which is a basalt stone 3 x 4 x 10 ins., losely set and mkd. 1/4 on N. face, apparently scratched with a nail. I reestablish this cor. in its orig. position as follows: Set a basalt stone 24 x 15 x 6 ins. in a md. of stone on solid bedrock for 1/4 Sec. Cor. between Secs. 21 & 28, mkd. 1/4 on N. face. I place orig. stone in the md. alongside.
From Which: A juniper 36 ins. diam., brs. S68°15'W., 87 lks dist. mkd 1/4 S28 BT (New BT)
A juniper 20 ins. diam., brs. N22°15'W., 90 lks dist. mkd 1/4 S21 BT (New BT)

RESTORATION BY, STAMP AND DATE:

R. D. BAGETT
W. GENTIS



FEB. 24, 1976

GRANT COUNTY SURVEYOR

EVIDENCE FOUND:

Found stone 24" x 15" x 6" mkd 1/4 set in mound of stone by Woodward in 1917 (H.E.S. 217)
Also fd 3" x 4" x 15" stone dimly mkd 1/4.
From Which: OLD BTs as set in 1917 (H.E.S. 217) by Woodward.
A 30" juniper brs. N. 22° W. 61.0 ft. dist. mkd 1/4 S21 T15SR32E BT
A 40" juniper brs. S. 70° W. 57.4 ft. dist. mkd 1/4 S28 T15SR32E

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:


Show how trees are scribed and basis of bearings, including compass var.

At corner point: Set 1 1/2" x 30" iron pipe 8" in ground on solid rock in a large md of stone, with brass cap mkd as shown. Place both mkd stones upright alongside pipe.

I did not take new trees as Woodward's BTs are in good shape.

Used compass with 20° East Var. and steel tape measuring to center of trees.

MONUMENT MARKED

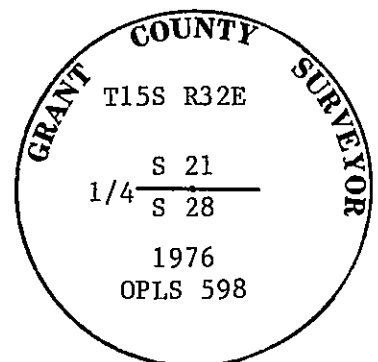

See Map of Survey No. 398

RECEIVED AND
FILED

NOV 29 1976

JOHN LIVEIRA, County Clerk

By *Darlene Lemmon* Deputy