

CORNER RESTORATION


W 1/4 Cor.
CORNER Sec. 28 TWP 15 S RANGE 32 E.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 384

CONTRACT DATE: Mar. 29, 1881

RETRACEMENT: W.M.H. Woodward
H.E.S. 217
Feb. 24, 1917

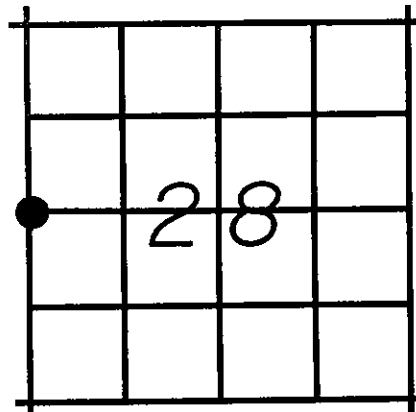

ORIGINAL DESCRIPTION:

40.00 Set stone 14 x 12 x 12 in mound of stone for 1/4 Sec. Cor.
1917 RETRACEMENT: 40.63 Fall 37 lks. W. of 1/4 Sec. Cor. between Secs. 28 and 29, which is basalt stone 14 x 12 x 12 ins. Since the markings are now illegible, I reestablish the corner in its orig. position as follows: Set a basalt stone, 14 x 12 x 12 ins., 10 ins. in the ground for 1/4 Sec. Cor. between Secs. 28 & 29, marked 1/4 on W. face.
From Which: A pine 10 ins. diam., brs. N. 33° 30' E., 50 lks dist. mkd 1/4 S28 BT (New BT)
A Pine 7 ins. diam., brs. S. 62° 15' W., 57 lks dist. mkd 1/4 S29 BT (New BT)

RESTORATION BY, STAMP AND DATE:

R. D. BAGETT
W. GENTIS



FEB. 22, 1976

GRANT COUNTY SURVEYOR

EVIDENCE FOUND:

I did not find the orig. cor. stone. However, I did find both BTs as described in 1917 H.E.S. Survey No. 217
I establish corner at record bearing and distance from these BTs.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At Corner Point: Set 1 1/2" x 30" iron pipe 26" in the ground with brass cap mkd as shown.


From Which: Woodwards BTs

A 30" pine brs. N. 33° E. 33 ft. dist. with scribing visible in blaze that had been opened several years ago.
A 24" pine brs. S. 62° W. 37.6 ft. with scribing blaze completely healed. I did not open blaze.

Used compass with 20° East Var. and steel tape measuring to center of BTs.

See Map of Survey No. 398

MONUMENT MARKED

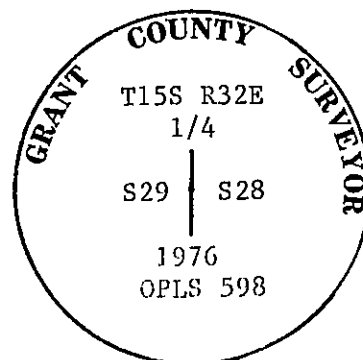

RECEIVED AND
FILED

NOV 29 1976

JOHN LIVEIRA, County Clerk
By *Carlene Lemon* Deputy