


CORNER RESTORATION

S.W. Cor.
CORNER Sec. 30 TWP 15S RANGE 32E, W.M.

ORIGINAL SURVEY BY: Bamford Robb

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

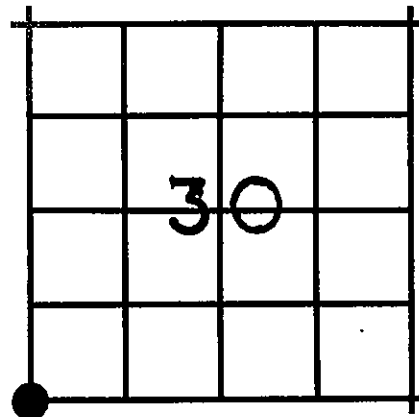

ORIGINAL DESCRIPTION:

80.00 Set post for cor. to Sec's 30, 31, 25 & 36
A Pine 18 in. in diam. brs. N. 60° E., 46 lks dist.
A Pine 36 in. in diam. brs. S. 48° W., 46 lks dist.

RECEIVED AND
FILED


DEC 20 1976
John Liveira
JOHN LIVEIRA, County Clerk

RESTORATION BY, STAMP AND DATE:

R. D. BAGETT
W. GENTIS

REGISTERED
PROFESSIONAL
LAND SURVEYOR

By _____ Deputy

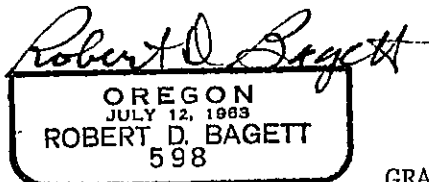

MAY, 1976

GRANT COUNTY SURVEYOR

EVIDENCE FOUND:

Found remains of original corner post and 2 BT stumps as follows:

A 20" pine stump bears N. 60° E., 30.4 feet with partial scribing visible.
A 30" pine stump bears S. 84° W., 42.9 feet marked S36 T15 R31.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a 1½"x30" iron pipe 20" in the ground with brass cap marked as shown. From which I scribe
NEW BEARING TREES:

A 7" red fir bears N. 38° E., 46.8 feet marked T15S R32E
S30CSBT
A 10" red fir bears S. 67° E., 20.0 feet marked T15S R32E
S31CSBT
A 9" red fir bears S. 42° W., 34.1 feet marked T15S R32E
S36CSBT
An 18" red fir bears N. 20° W., 14.1 feet marked T15S R32E
S25CSBT.

Surrounded pipe with mound of stone. Corner is 70 feet North of forest road. Cors. E and W. Used compass with 20° East variation and steel tape, measuring to face of BT blaze.

MONUMENT MARKED

