


CORNER RESTORATION

S. 1/4 Cor.
CORNER Sec. 29 TWP 15 S., RANGE 32 E.
ORIGINAL SURVEY BY: Samuel W. Lackland
CONTRACT NUMBER: 384
CONTRACT DATE: Mar. 29, 1881

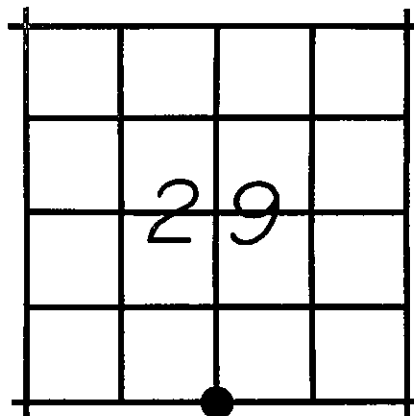

ORIGINAL DESCRIPTION:

39.86 Set stone 16 x 10 x 6 in mound of stone for $\frac{1}{4}$ Sec. Cor. from which a mahogany 8 in. diam. brs. N4°W., 9 lks dist.

RESTORATION BY, STAMP AND DATE:

R. D. BAGETT
W. GENTIS

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1983
ROBERT D. BAGETT
598

MARCH 22, 1976

GRANT COUNTY SURVEYOR

EVIDENCE FOUND:

Found Orig. corner stone 16" x 10" x 6" dimly mkd $\frac{1}{4}$ at record bearing & dist. from Orig. BT which is a live 10" mahogany that brs. N4°W. 5.94 ft. dist. Partial scribing visible, blaze is almost closed.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.


At corner point: Set $1\frac{1}{2}$ " x 30" iron pipe 28" in the ground with brass cap mkd as shown in a md. of stone.
Buried Orig. Stone East and alongside iron pipe.

MONUMENT MARKED

From which: I scribe NEW BT.

A 7" mahogany brs. S. 71° W. 33.5 ft. dist. mkd $\frac{1}{4}$ S32° CSBT

Used compass with 20° East Var. and steel tape measuring to face of BT blaze.

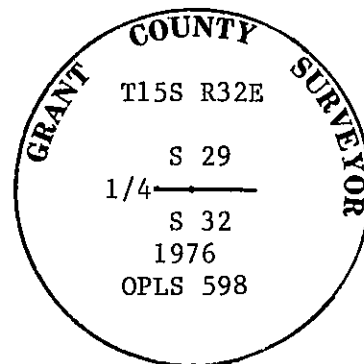

RECEIVED AND
FILED

See Map of Survey No. 398

NOV 29 1976

JOHN LIVEIRA, County Clerk

Darlene Lemon
By _____ Deputy