


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1900 by George R. Campbell
a spruce, 12" in diam, for 1/4 Section corner, marked
1/4 S7 on west side and 8 on east side, from which:
a spruce, 12" in diam., bears N32°E, 15 lks.
a spruce, 12" in diam., bears S80°W, 6 lks.

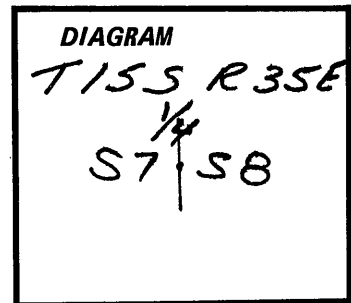

Description of corner evidence found:

Found bearing trees:

14" Spruce snag, N40°E, 9.9', Scribed 1/4S, B.T.
14" Spruce snag, N66°W, 4.0', Scribed 1/4S, B.T.

Found corner tree.

Description of monument and accessories I established to perpetuate the
original location of this corner:

Set 2½" Brass Cap on 2" galvanized pipe 30" long 5' north of tree on line.



New Bearing trees:

10" Fir, N26°E, 33.9', Scribed 1/4 S8, B.T.
8" Black Pine, N31°W, 31.4', Scribed 1/4 S7, B.T.

All B.T.'s have sign 54-4 & 54-3 attached. Set steel guard post with 54-9 sign,
3' north of monument. Painted red band around bearing trees. Tagged trees with
L.S. 980 wahser.

MONUMENT STAMPED:

Witnesses: David Scott, Party Chief
Richard Larson, Chainman

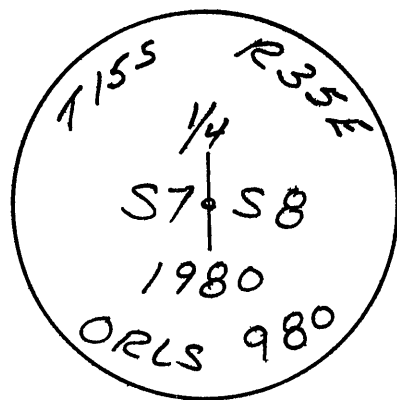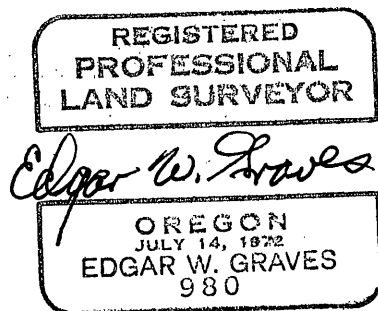

Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*..... I hereby certify that the within instrument was filed in this office
for record on the.....*14* day of.....*Jan*....., 19*81*.....
Robert D. Dwyer by.....
(COUNTY OFFICIAL) (DEPUTY)