


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

ORIGINAL RECORD: none

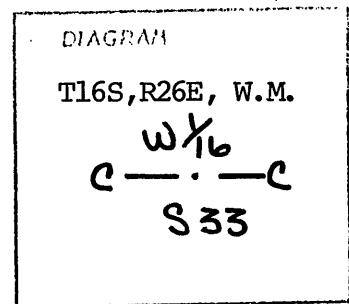

Description of corner evidence found:


None.

I chained BTN. the Center one quarter monument (galvanized iron pipe with brass cap) as set by M. A. Palmer in 1964, to the West one quarter corner, Section 33 (galvanized iron pipe with brasscap) set by BIM and placed this monument on line between them and halfway between. Total distance = 2704.22 ; Half distance = 1352.11

Description of monument and accessories I established to perpetuate the original location of this corner


Set 2" X 3 0" galvanized iron pipe in a mound of stones with a 2 1/4" brass cap marked as shown:

BRASS CAP:

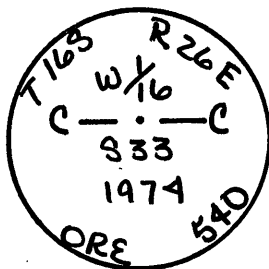

B.T.'s SET:

24" Ponderosa Pine, South 66° West, 14.9 feet; scribed WC 1/16, S33 BT
 24" Ponderosa Pine, South 53° 30' East, 40.9 feet; scribed WC 1/16, S33 BT

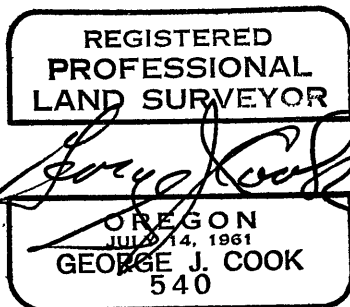

I hereby certify that the above corner was re-established as herein described.

Witnesses: s/ Bill McPhee
 s/ Garry Maddux

Office of County Surveyor County of Grant
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 9th day of September, 1974, at 2 o'clock P.m., (signed)
Robert D. Sagitt by _____
 (COUNTY OFFICIAL) (DEPUTY)