

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Samuel W. Lackland, Deputy Surveyor, under G.L.O. Contract No. 415 dated August 19, 1881.

Surveyor General's record states:

N. bet. Secs 1 & 2 VA 18° E

67.50 Intersect 3rd Standard S 950 Lks W. of Cor. to Secs 35 & 36 which is a stone 16X12X10 ins marked with 1 notch on E and 5 notches on W. edges from which a Pine 36 ins. diam bears N40°W 142 Lks dist marked T15SR27ES35SCBT A Pine 18 ins diam bears N60°E 91 Lks dist marked T15SR27ES36SCBT at which

point I set a basalt stone 16X10X7 ins. 12 ins. in ground for C. Cor to Secs 1 & 2 marked with 1 notch on E. and 5 notches on W. edges and CC on S. face from which a Pine 52 ins. diam. bears N8°E 49 Lks dist marked T15SR27ES35CCBT A Pine 60 in. diam. bears S4°W 161 Lks dist marked T16SR27ES2BT

Description of corner evidence found:

(CONTINUED ON SECOND SHEET)

At assumed corner location found 40d nail and lathe presumably from C.S. 897 by Robert D. Bagett, LS 598, at proportional distances from the original bearing trees. Excavating at this point found remains of rotted wood hub and buried and broken glass bottle alongside nail. Found: original NE BT, a 59" Ponderosa Pine sawed stump with visible scribing "CC" chaining notch "BT", log to mill, bears North 11° East, 32.4 ft. to chaining notch; original SW BT, a 63" Ponderosa Pine sawed stump with visible scribing "R27ES2" chaining notch "BT", log to mill, bears South 7° West, 110.1 ft. to chaining notch. I believe rotten wood hub and glass from BLM 1975 survey. Bagett had retracement bearing and distance to this point on C.S. 897 with which I closely agree. I determine to accept the nail position and remonument with aluminum cap monument.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position of 40d nail as set by Bagett and at proportional distances from original bearing trees, set 2-1/2 inch O.D. X 30 inches long aluminum pipe 24 inches in ground with 3 inch aluminum cap marked as shown:


A 14" Ponderosa Pine bears South 16° East, 32.6 ft., scribed-T16SR27ES1CCBT;

A 17" Ponderosa Pine bears South 51° West, 49.9 ft.; scribed-T16SR27ES2CCBT.


Raised stone mound 2-1/2 foot diam. to cap. Set steel post 5 feet South with sign 54-4 facing corner. Painted red band and faces red and nailed signs 54-3 and 54-4 to BT's. Nailed brass washer stamped "AS&E LS1026" to face of bearing trees.

I hereby certify that the above corner monument was re-established as herein described on May 7, 1987.

Witnesses: David B. Armstrong
Shelby H. Griggs

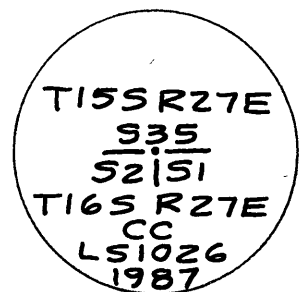

M.V.19-1/2°E.

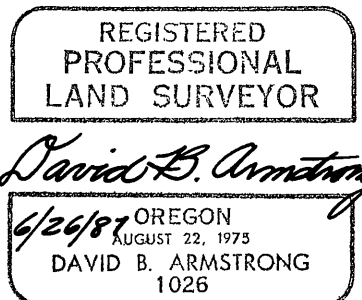

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 6 day of Aug, 1987
Robert D. Bagett by _____
(COUNTY OFFICIAL) (DEPUTY)