


CORNER RESTORATION

CORNER: NW Cor. Sec. 10 Twp. 16 S. Range 27 E., W.M.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 415

CONTRACT DATE: August 19, 1881

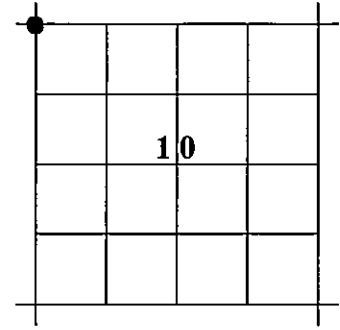

Subsequent surveys:

- Gary Oviatt & Wayne Rogers in 1975 under special instructions dated August 25, 1975, Survey/Group No. 882

ORIGINAL DESCRIPTION: Set basalt Stone 18x12x7 ins. 14 ins. in ground for Cor to Sec's 3, 4, 9 & 10. Marked with 5 notches on S and 3 notches E edges. Raised Mound of Stone 2½ ft. high 5 ft. base, alongside.

- 1975: Point for the cor. of secs. 3, 4, 9, and 10, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.

T 16 S R 27 E
S 4 S 3
S 9 S 10
1976

from which

A ponderosa pine, 12 ins. diam., bears N. 20° E.,
5 lks. dist., mkd. T16S R27E S3 BT.

A ponderosa pine, 12 ins. diam., bears S. 72½° E.,
29 lks. dist., mkd. T16S R27E S10 BT.

A ponderosa pine, 7 ins. diam., bears S. 34½° W.,
11 lks. dist., mkd. T16S R27E S9 BT.

A ponderosa pine, 7 ins. diam., bears N. 82° W.,
25 lks. dist., mkd. T16S R27E S4 BT.

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

DEC 3 2010

BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

November 30, 2010

Grant County Surveyor

EVIDENCE FOUND: None. No field visit was made for this Corner Restoration Report, it is prepared from record information. See Record Map of Survey No. 889 filed in the office of the Grant County Surveyor.