


CORNER RESTORATION

CORNER: S1/4 Cor. Sec. 2 Twp. 16 S. Range 27 E., W.M.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 415

CONTRACT DATE: August 19, 1881

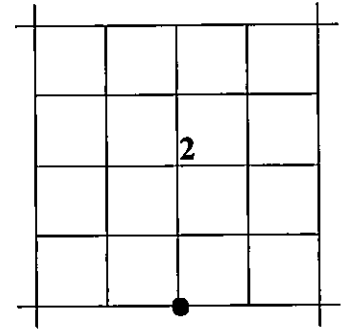

Subsequent surveys:

- Gary Oviatt & Wayne Rogers in 1975 under special instructions dated August 25, 1975, Survey/Group No. 882

ORIGINAL DESCRIPTION: Set basalt Stone 15x12x8 ins. 10 ins. in ground. Marked for 1/4 Sec. Cor. with 1/4 on N. face. From which a Pine 30 ins. diam. bears S86°W 14 lks. dist. Marked 1/4 S BT. A Pine 24 ins. diam. bears S26°E 39 lks dist. Marked 1/4 S BT.

► 1975:

From the 1/4 sec. cor. of secs. 2 and 11, monumented with the original basalt stone, 15 x 12 x 8 ins., firmly set 10 ins. in the ground, mkd. 1/4 on N. face, from which the remains of the original bearing trees:

A sawed and decayed ponderosa pine stump, 35 ins. diam., bears S. 42° E., 42 lks. dist., no marks visible. (Record, S. 26° E., 39 lks.)

A sawed and decayed ponderosa pine stump, 38 ins. diam., bears S. 74° W., 16 lks. dist., with illegible scribe marks visible on decayed blaze. (Record, S. 86° W., 14 lks.)

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.

T 16 S R 27 E
1/4 S 2
S 11
1976

from which new bearing trees

A ponderosa pine, 20 ins. diam., bears N. 47° W., 63 1/2 lks. dist., mkd. 1/4 S2 BT.

A ponderosa pine, 16 ins. diam., bears S. 62 1/2° W., 59 lks. dist., mkd. 1/4 S11 BT.

Deposit corner stone alongside iron post.

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

NOV 12, 2010

BY

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

November 12, 2010

Grant County Surveyor

EVIDENCE FOUND: None. This Corner Restoration Report is prepared from record information.