


CORNER RESTORATION

CORNER: W1/4 Cor. Sec. 22 Twp. 16 S. Range 27 E., W.M.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 415

CONTRACT DATE: August 19, 1881

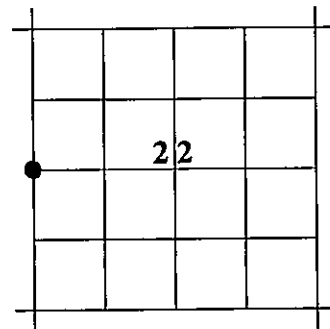

Subsequent surveys:

- Gary Oviatt & Wayne Rogers in 1975 under special instructions dated August 25, 1975, Survey/Group No. 882

ORIGINAL DESCRIPTION: Set basalt Stone 16x9x4 ins. 10 ins. in ground for 1/4 Sec. Cor. Marked 1/4 on W. face. From which: A Pine 20 ins. diam. bears N80°E, 18 lks. dist. marked 1/4 S BT, A Pine 7 ins. diam. bears N14°W, 65 lks. dist. marked 1/4 S BT.

- 1975: The 1/4 sec. cor. of secs. 21 and 22, determined at record bearing and distance from the remains of the original bearing trees:

A ponderosa pine, 26 ins. diam., bears N. 80° E., 18 lks. dist., with scribe marks 1/4 S visible on partially healed blaze.

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 18 ins. in the ground, to solid rock, and in a mound of stone, 1 1/2 ft. base, to top, with brass cap mkd.

T 16 S R 27 E
1/4
S 21 | S 22
1976

from which a new bearing tree

A fir, 10 ins. diam., bears N. 38° W., 22 1/2 lks. dist., mkd. 1/4 S21 BT.


RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

NOV 15, 2010

BY:

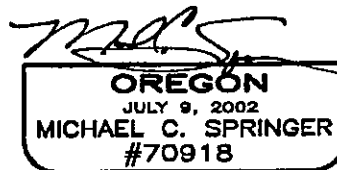

EXPIRES: 6/30/2012

November 15, 2010

Grant County Surveyor

EVIDENCE FOUND: None. This Corner Restoration Report is prepared from record information.