


CORNER RESTORATION

CORNER: S1/4 Cor. Sec. 33 Twp. 16 S. Range 27 E., W.M.

ORIGINAL SURVEY BY: Bamford Robb

CONTRACT NUMBER: 366

CONTRACT DATE: August 18, 1880

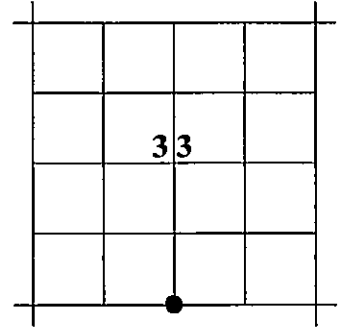

Subsequent surveys:

- ▶ Gary Oviatt & Wayne Rogers in 1975 under special instructions dated August 25, 1975, Survey/Group No. 882


ORIGINAL DESCRIPTION: Set stone 14x10x6 for 1/4 sec. cor from which
a pine 48 in. dia. bears N25°E. 55 lks dist.
a pine 6 in. dia. bears S50°W. 28 lks dist.

- ▶ 1975: Oviatt's and Rogers' field notes state: the 1/4 sec. cor. of secs. 4 and 33, monumented with the original basalt stone 14x10x6 ins. loosely set in a small mound of stone, with fragmentary chisel marks visible on N. face, from which the remains of the original bearing tree:
A ponderosa pine, 10 ins. diam., bears S.50°W., 28 lks. dist. with scribe marks 1/4 S visible on opened blaze.
At the corner point Set an iron post, 28 ins. long, 2½ ins. diam., 18 ins. in the ground, to solid rock, and in a mound of stone 2½ ft. base, to top, with brass cap mkd.
From which
A juniper, 11 ins. diam. bears N.39¼°W., 133 lks dist., mkd. 1/4 S33 BT
A ponderosa pine, 13 ins. daim. bears S.17½°E., 59½ lks dist., mkd. 1/4 S4 BT
Deposit corner stone alongside iron post.

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

NOV 3, 2010
BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2012

November 3, 2010

Grant County Surveyor

EVIDENCE FOUND: None. This Corner Restoration Report is prepared from record information.

RECORD MARKINGS ON BRASS CAP PER BLM FIELD NOTES

T16S R27E

1/4 $\frac{S33}{S4}$

T17S

1975