


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by S. W. Lackland under joint contract #357, dated July 2, 1880.
Surveyor General's records state: Set post with pit and mound from which;
a pine 36" in diameter bears S 20° W 115 links distance.

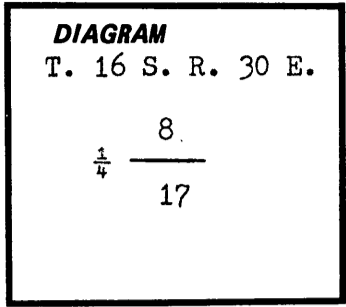

Description of corner evidence found:

Found no evidence of original post, pit and mound, or bearing tree.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set by single proportionate measurement, a 2½"x30" aluminum pipe with ¾" aluminum cap, 24" in ground in mound of stone. Cap marked;

Bearing trees

a ponderosa pine 11" in diameter bears S 57° W 60.6 feet distance, scribed "¼S17" in upper blaze and "BT" and brass tag stamped RLS 1664 in lower blaze.

a ponderosa pine 13" in diameter bears N 67½° E 29.7 feet distance, scribed "¼S8" in upper blaze and "BT" and brass tag stamped RLS 1664 in lower blaze.

Compass declination 18° East

Note

I set a steel fence post with USFS Attention sign at corner, placed USFS bearing tree signs on all bearing trees, and painted red band on smooth bark at breast height on all bearing trees.

I hereby certify the above corner location was perpetuated as herein described on July 22, 1981.

Terry Butler Terry Butler, Witness

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Carl E. Sundet
OREGON
JULY 14, 1978
CARL E. SUNDET
1664

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 23 day of Oct, 1981.
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)