


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by S. W. Lackland, under joint contract #357, dated July 2, 1880. Surveyor General's records state; Set post with pits and mound from which; a pine 40" in diameter bears S 87°W 195 links distance

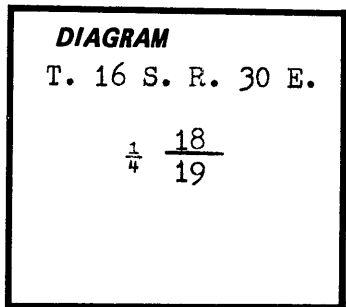

Description of corner evidence found:

Found no evidence of original post, pits and mound or bearing trees.


Description of monument and accessories I established to perpetuate the original location of this corner:

Set by single proportionate measurement, a 2½"x30" aluminum pipe with a ¾" aluminum cap, 10" in ground to bedrock in large mound of stone. Cap marked;

Bearing trees

a ponderosa pine 15" in diameter bears N 10½°W 87.0 feet distance, scribed "¼S18" in upper blaze and "BT" and brass tag stamped RLS 1664 in lower blaze.

a ponderosa pine 14" in diameter bears S 07°E 90.6 feet distance, scribed "¼S19" in upper blaze and "BT" and brass tag stamped RLS 1664 in lower blaze.

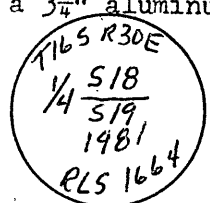

Note Compass declination 18° East

I set steel fence post with USFS Attention sign, placed USFS bearing tree signs on all bearing trees, and painted red band on smooth bark band at breast height on all bearing trees.

Terry Butler Terry Butler, Witness

I hereby certify the above corner location was perpetuated as herein described on July 22, 1981.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Carl E. Sundet

OREGON
JULY 14, 1978
CARL E. SUNDET
1664

Office of... Surveyor ... County of... Grant ...
State of... Oregon ... I hereby certify that the within instrument was filed in this office
for record on the... 23 day of... Oct ... 19... 81
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)