


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established under joint contract #357, dated July 2, 1880 by S. W. Lackland, interiors, and Bamford Robb, exteriors.

Surveyor General's records state: Set post with pit and mound. From which; a pine 36" in diameter bears N 72° E, 62 links

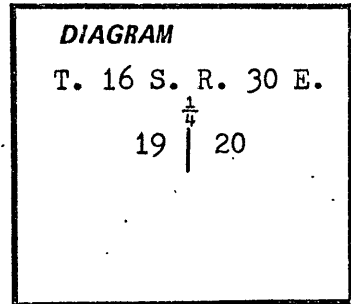


Description of corner evidence found:

Found: No evidence of original post. Found: 59" Ponderosa Pine stump scribed "BT", N 72° E, 62 links

Description of monument and accessories I established to perpetuate the original location of this corner: As no evidence of original post was found, set corner from record bearing and distance to original bearing tree. At corner position, I set a 2 1/2" x 30" aluminum pipe with 3/4" aluminum cap 24" in ground. Marked

Bearing trees a 10" Ponderosa Pine, diameter, bears S 73° W, 25.4 ft., scribed "1/4 S19" in upper blaze and "BT" and brass washer stamped RLS 1664 in lower blaze. a Juniper, 7" in diameter, bears S 25° E, 38.3 ft., scribed "1/4 S20" in upper blaze and "BT" and brass washer stamped RLS 1664 in lower blaze. Compass declination 19° East

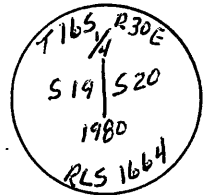

Original bearing trees a Ponderosa Pine stump, 59" in diameter, bears N 72° E, 62 links Compass declination 19° East

Note; I set steel fence post with USFS Attention sign north of corner.

I certify the above corner location was perpetuated as herein described in December, 1980.

Terry Butler, Witness

REGISTERED PROFESSIONAL LAND SURVEYOR

Carl E. Sundet

OREGON JULY 14, 1978 CARL E. SUNDET 1664

Office of Surveyor County of Grant State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 13 day of Feb, 1981. Robert D. Day (COUNTY OFFICIAL) by (DEPUTY)