


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Samuel W. Lackland, deputy surveyor, under G.L.O. contract No. 357 dated July 2, 1880. Surveyor general's record states: North between Sections 11 and 12. Va. 18° 30' East.

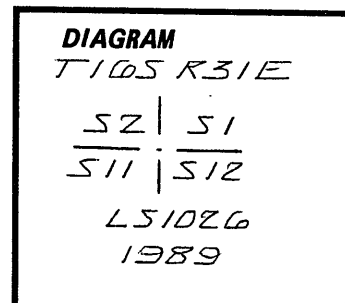

E - 21
F.B. 6 P. 71,72

80.00 Set a basalt stone 12"x10"x10" in a mound of stone for corner to Sections 1, 2, 11, and 12 from which, a Pine 10" in diameter bears South 30° East, 148 Lks. dist.; a Pine 14" in diameter bears South 50° West, 95 Lks. dist.; a Pine 16" in diameter bears North 40° West 5 Lks. dist.; a Pine 18" in diameter bears North 25° East, 70 Lks. dist.

Description of corner evidence found:

At assumed corner location found original Northwest bearing tree, a 22" Ponderosa Pine snag bears North 40° West, 3.3 ft., to face with visible scribing "S2T16R31BT"; found original Northeast bearing tree, a 27" Ponderosa Pine bears North 38-3/4° East, 54.9 ft. (Record North 25° East, 46.2 ft.), visible scribing "S1T16R31BT"; remains of original Southeast bearing tree, a 23" Ponderosa Pine rotten stump hole bears South 26-1/4° East (Record South 30° East), 97.7 ft., no face remains. No evidence remains of original Southwest bearing tree. At record bearing and distance from Northwest bearing tree found stone depression where cap is set. Found original stone 17"x9"x9" lying on top of rock jack with 5 grooves. Very rough stone.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position as determined from original bearing trees, set a 2-1/2"O.D.x30" long aluminum pipe 26" in ground with a 2-1/2" diameter aluminum cap marked as shown: Deposited original stone North of cap and raised a 2-1/2 ft. diameter stone mound to cap.


Marked Bearing Trees:

An 18" Ponderosa Pine bears South 75-1/4° East, 31.9 ft., scribed "T16SR31ES12BT"; a 14" Ponderosa Pine bears South 12-1/2° West, 37.6 ft., scribed "T16SR31ES11BT"; a 7" Ponderosa Pine bears North 16-1/2° West, 24.5 ft., scribed "T16SR31ES2BT". Painted a 6" red band and face blazes red. Nailed signs 54-9 and 54-3 to BT's. Nailed a brass washer stamped "LS 1026" to face blazes of BT's. Set a steel fence post 5 ft. South of cap with sign 54-9. Bearings are by staff compass and declination is 19-1/2° East.

I hereby certify that the above corner monument was re-established as herein described on August 30, 1989.

Witnesses: Wes G. Heigh
Paul D. Woodworth

See C.S. #1124

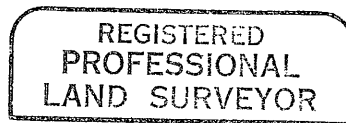

David B. Armstrong

12/22/89 OREGON
AUGUST 22, 1975
DAVID B. ARMSTRONG
1026

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 13 day of Feb, 1990
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)