


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Samuel W. Lackland, deputy surveyor, under joint G.L.O. contract No. 357 dated July 2, 1880. Surveyor general's record states: South 89° 59' West on true line between Sections 11 and 12.

39.91 Set post for 1/4 section corner with pits and mound as per instructions.

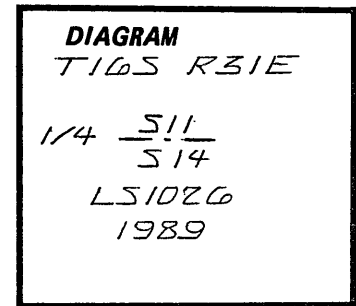

J - 19
F.B. 7 P. 65,66,67

Description of corner evidence found:

At assumed corner location no evidence of post, pits, or mound were found. Corner area falls in sage flat approximately 150 ft. North of cultivated hay field. Corner is considered lost.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position as determined by survey, set a 2-1/2" O.D. x 30" long aluminum pipe 26" in ground with a 2-1/2" diameter aluminum cap marked as shown: No stone available for mound.

Marked Bearing Tree:

A 21" Ponderosa Pine bears North 62° East, 156.5 ft., scribed "1/4S11BT". Painted a 6" red band and face blaze red. Nailed signs 54-9 and 54-3 to BT. Nailed a brass washer stamped "LS1026" to face blaze.


Reference Monument Set:

A 1"x24" long iron rod bears South 28-1/4° East, 25.98 ft., stamped "RM S14 LS1026 1989". Set a steel post 1 ft. past RM on line with cap with sign 54-9 facing RM. Set a steel post 5 ft. North of cap with sign 54-9. Bearings are by staff compass and declination is 19-1/2° East.


I hereby certify that the above corner monument was re-established as herein described on October 19, 1989.

Witnesses: Wes G. Helgh
Paul D. Woodworth

See C.S. #1124



David B. Armstrong



Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*....., I hereby certify that the within instrument was filed in this office
for record on the.....*13* day of.....*Feb*....., 19.....*90*.....
.....*Robert D. Bryant*..... by.....
(COUNTY OFFICIAL) (DEPUTY)